AURORA, COLORADO

HI-TACAN RWY 32

TACAN BKF Chan 33	APCH CRS 328°	Rwy ldg 11,006 TDZE 5663 Arpt Elev 5663	JAL-538 [USAF]	BUCKLEY AFB (KBKF)

* When ALS inop, increase CAT CDE vis to 1¾ miles.
** Circling NA East of Rwy 14-32.

ALSF-1

MISSED APPROACH: Climbing right turn to 8200 and intercept BKF TACAN R-148 direct BEKEE and hold or as directed by ATC.

ATIS *	DENVER APP CON	BUCKLEY TOWER *	GND CON	CLNC DEL
119.675 259.3	128.45 251.075	121.0 291.675	121.6 275.8	121.6 275.8

Missed approach requires use of RNAV or ATC RADAR monitoring.

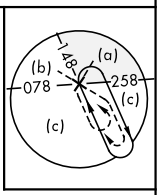

BUCKLEY
Chan 33 BKF

CAT E remain within 4.25 NM of Rwy when circling.

6070
5904
6074
LASTE BKF 4
6236
MUSOE BKF 6.5 /RADAR
6525
(IF) BEKEE BKF 13
6566
DERYL BKF 16
7048
148°
328°
Max holding alt 10,000
Min holding alt 8200
8554
(IAF) KATTT BKF 28
7088
Max holding alt 12,000
Min holding alt 10,000
148°
328°
R-148
7621
MSA BKF 25 NM
125°
7600
10,800
030°
300°
9600

EMERG SAFE ALT 100 NM 16,500

8200
BKF R-148
BEKEE BKF 13

TACAN
CENAR 1.7
3
LASTE 4
MUSOE 6.5 /RADAR
BEKEE 13
DERYL 16
KATTT 28
328°
10,000
8100
8000
7400
6600
3.02°
TCH 45
.5 NM
2.3 NM
2.5 NM

ELEV 5663
TDZE 5663

14
5732
5714
5694
5846
TWR 5700
5614
0.7% DOWN
11,006 × 150
5708
32

CATEGORY	C	D	E
S-32 *	6280-1⅜ 617 (700-1⅜)		
C CIRCLING **	6360-2 697 (700-2)	6400-2¼ 737 (800-2¼)	6420-2¾ 757 (800-2¾)

REIL Rwy 14
HIRL Rwy 14-32
328° to TACAN

AURORA, COLORADO 39°42′N-104°45′W BUCKLEY AFB (KBKF)

Amdt 3 27APR17

HI-TACAN RWY 32

SW-1, 17 JUN 2021 to 15 JUL 2021