FALLON, NEVADA

HI-TACAN RWY 31 L/R

FALLON NAS (VAN VOORHIS FLD) (KNFL)

JAL-143 [USN]

TACAN NFL Chan 82	APCH CRS 297°	Rwy ldg 31L 14,001 31R 11,076 TDZE 31L 3927 31R 3928 Arpt Elev 3935

† MISSED APPROACH: Climb direct NFL TACAN, then climbing right turn to 9000. Intercept NFL R-022 outbound to PILOW and hold. Missed approach requires minimum climb of 285 ft/NM to 9000.

ATIS ★	NAVY FALLON APP CON	NAVY FALLON TOWER ★	GND CON	CLNC DEL	ASR/PAR
370.925	120.85 360.2	119.25 340.2	251.15	353.55	

† CAUTION: Missed Approach Minimum Climb Rate to 9000

Knots	60	120	180	240	300	360
V/V(fpm)	285	570	855	1140	1425	1710

ATC Minimum Climb Rate

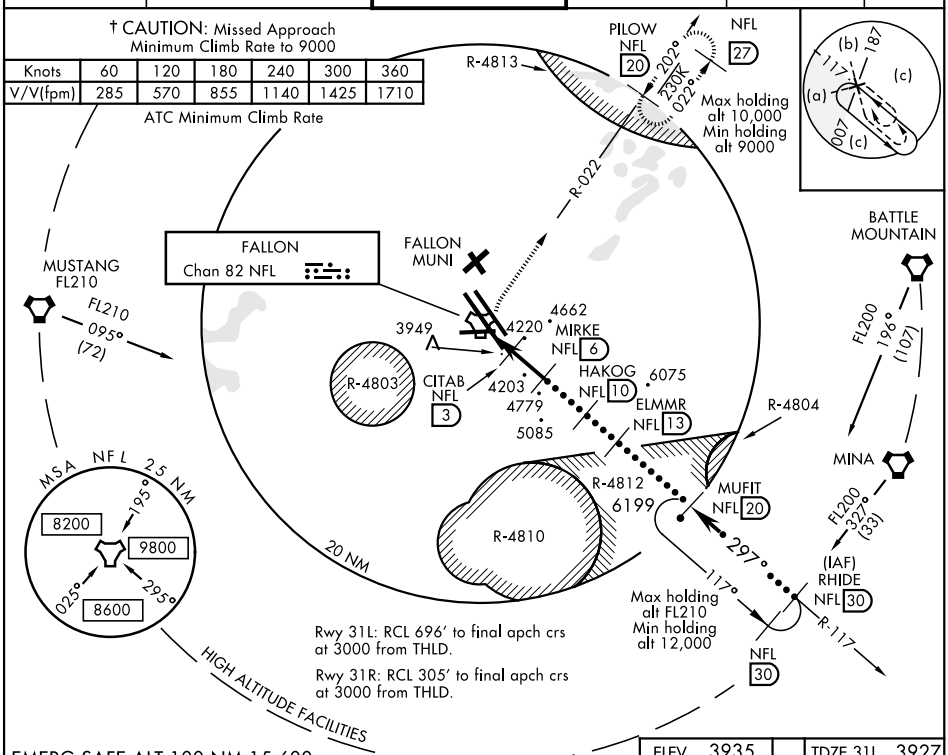

EMERG SAFE ALT 100 NM 15,600

ELEV 3935	TDZE 31L 3927
	TDZE 31R 3928

9000 NFL | NFL R-022 | PILOW NFL 20

DA (3.36/3.38) not coincident with the VGSI.

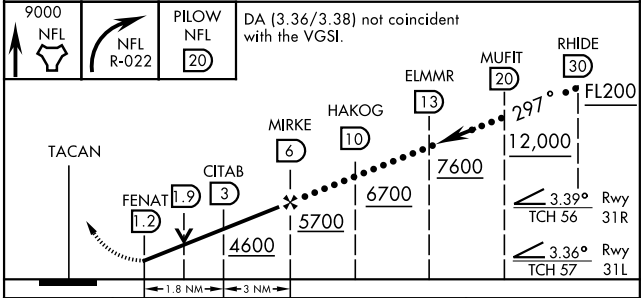

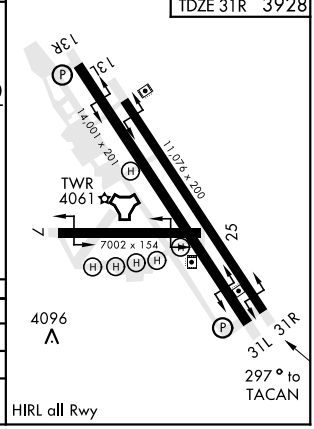

CATEGORY	C	D	E
S-31L	4240-1 313 (400-1)		
S-31R	4240-1 312 (400-1)		
C CIRCLING	4700-2¼ 765 (800-2¼)	4920-3 985 (1000-3)	4980-3 1045 (1100-3)

HIRL all Rwy

SW-4, 09 SEP 2021 to 07 OCT 2021