ILS or LOC RWY 10R
JOHN GLENN COLUMBUS INTL (CMH)

LOC/DME I-AQI	APP CRS	Rwy Ldg 10114
111.75	101°	TDZE 809
Chan 54 (Y)		Apt Elev 815

ADF required. DME or RADAR required.

Simultaneous approach authorized.

MALSR

MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct BU LOM and hold.

D-ATIS	COLUMBUS APP CON	COLUMBUS TOWER	GND CON	CLNC DEL	CPDLC
124.6	125.95 371.975	132.7 257.8	121.9 348.6	126.3	

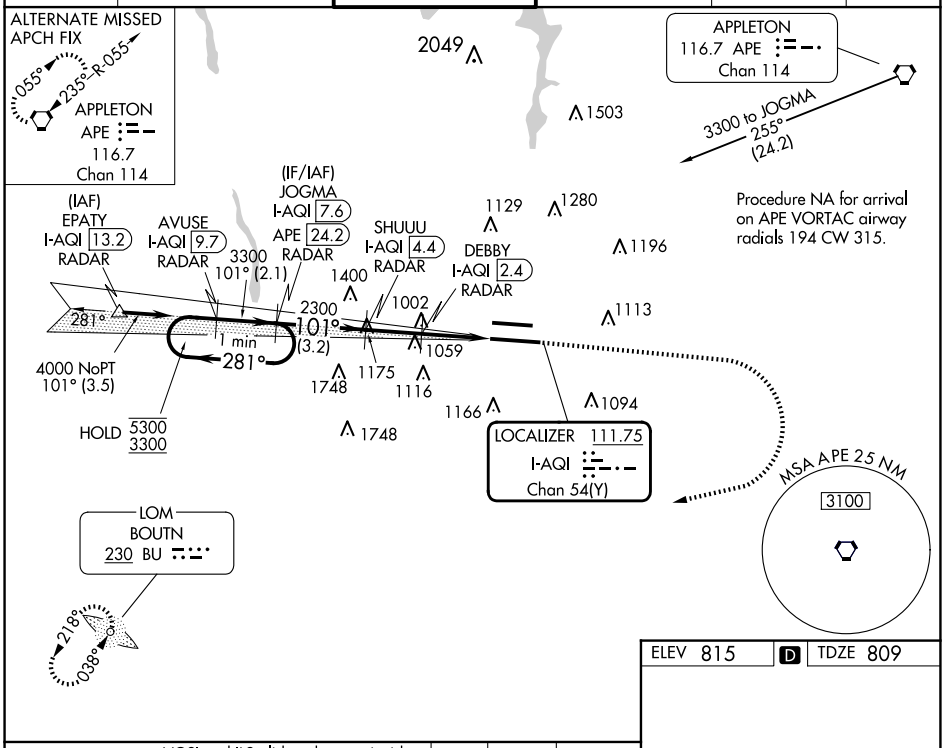

Procedure NA for arrival on APE VORTAC airway radials 194 CW 315.

ELEV 815 | D | TDZE 809

VGSI and ILS glidepath not coincident (VGSI Angle 3.00/ TCH 70).

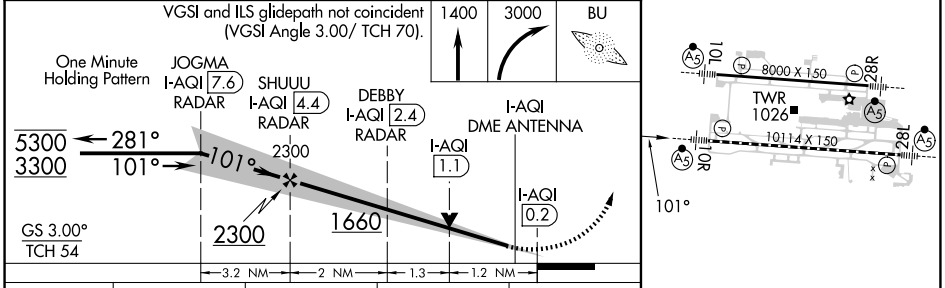

CATEGORY	A	B	C	D
S-ILS 10R	1009/18		200 (200-½)	
S-LOC 10R	1260/24 451 (500-½)		1260/45 451 (500-⅞)	
C CIRCLING	1340-1 525 (600-1)		1520-2 705 (800-2)	1520-2¼ 705 (800-2¼)

TDZ/CL Rwy 10R-28L
HIRL Rwys 10R-28L and 10L-28R

FAF to MAP 4.5 NM

Knots	60	90	120	150	180
Min:Sec	4:30	3:00	2:15	1:48	1:30

EC-2, 07 AUG 2025 to 04 SEP 2025
EC-2, 07 AUG 2025 to 04 SEP 2025