

Flight Procedure Tracking Form		Action: AMENDMENT	Task Type: IAP	Date Open: 10/10/2017	Task #: 2017101034458002003	Request #: 20171010344580
Procedure: VOR RWY 23 AMDT 13B			Airport ID: KGQQ	Airport: GALION MUNI		Reimbursable #: NO
City: GALION	ST: OH	GPS #:	Estimated Chart Date: 05/24/2018		FICO #:	
Fac ID: MFD		Fac. Type: VORTAC			Specialist: CHRIS O'BRIEN	
Procedure Review						
	Rec'd	Rel'd	Full Name	Comments		
Lead:	11/22/2017			QUALITY		
QA:				22 1.19.2018 BD		
Liaison:				CHECKED		
Procedure Comments:			Remark Type: INFORMATION			
FLIGHT INSPECTION REVIEW NOT REQUIRED-PROCESSED IAW AIRCRAFT OPERATIONS GROUP (AJW-333) MEMO, DECEMBER 22, 2017, CONTACT: JULIE MORGAN, MANAGER/DION LANCIA, LEAD: 405.954.8568/1267.						


VORTAC MFD	APP CRS	Rwy Idg	3504
108.8	224°	TDZE	1224
Chan 25		Apt Elev	1224

EXISTING

VOR RWY 23
GALLION MUNI (GQQ)

NA	Visibility reduction by helicopters NA. Procedure NA at night. Use Mansfield altimeter setting; when not received, use Marion altimeter setting and increase all MDA 40 feet and increase CUBYS fix minimums S-23 and Circling Cat C visibility 1/8 mile.	MISSED APPROACH: Climbing left turn to 2900 direct MFD VORTAC and hold.
----	---	---

MANSFIELD APP CON *	CLNC DEL	UNICOM
124.2 390.8	126.8	122.8 (CTAF) 0

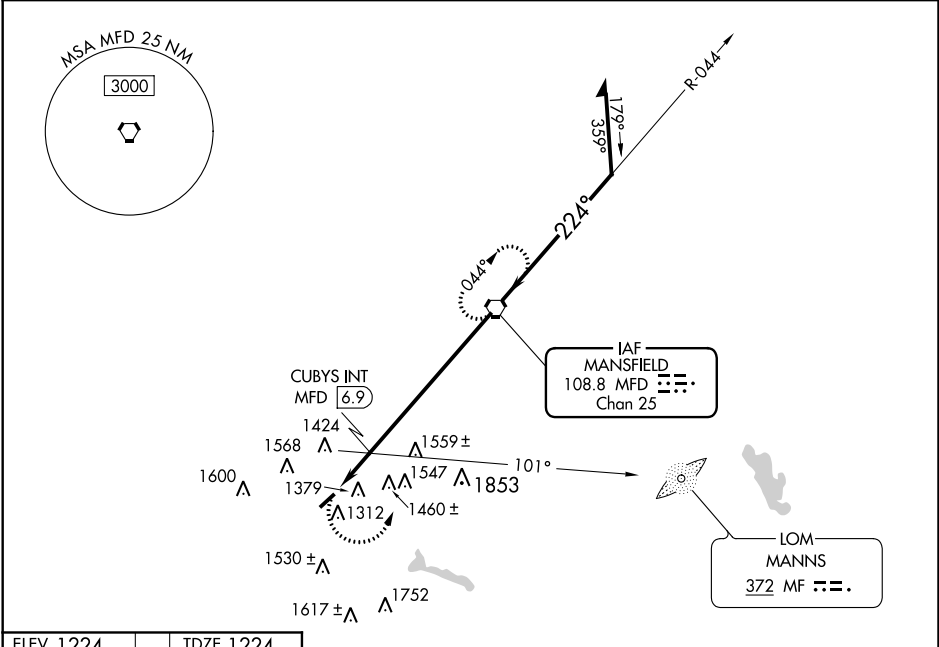

ELEV 1224	TDZE 1224	2900 MFD	VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 38).	MFD VORTAC	Remain within 10 NM
224° 8.9 NM from FAF		CUBYS INT MFD 6.9	3.49° TCH 40	044°	3000
3504 X75		MFD 8.9	*2000	224°	*2040 when using Marion altimeter setting.
MIRL Rwy 5-23 0					
REIL Rwy 5 and 23 0					
FAF to MAP 8.9 NM					
Knots	60	90	120	150	180
Min:Sec	8:54	5:56	4:27	3:34	2:58
CATEGORY	A	B	C	D	
S-23	2000-1 776 (800-1)	2000-1¼ 776 (800-1¼)	2000-2½ 776 (800-2½)	NA	
CIRCLING	2000-1 776 (800-1)	2000-1¼ 776 (800-1¼)	2000-2½ 776 (800-2½)	NA	
CUBYS FIX MINIMUMS					
S-23	1760-1	536 (600-1)	1760-1⅝ 536 (600-1⅝)	NA	
CIRCLING	1800-1	576 (600-1)	1800-1⅝ 576 (600-1⅝)	NA	