
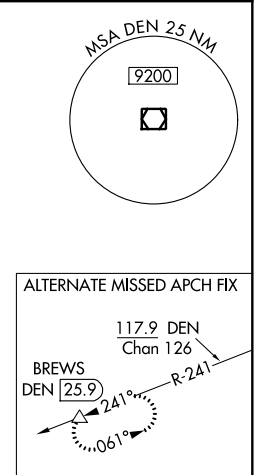
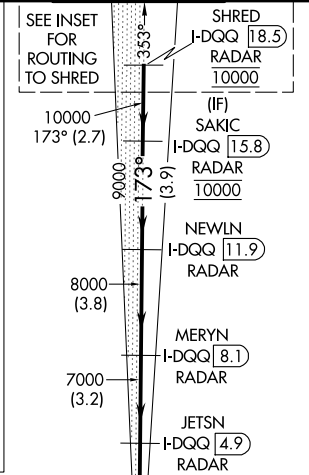


LOC/DME I-DQIQ 111.9 Chan 56	APP CRS 173°	Rwy Idg 16000 TDZE 5326 Apt Elev 5434
--	------------------------	--






ILS or LOC RWY 16R

DENVER INTL (DEN)

<p>▼ For inoperative MALSRR, increase S-LOC Cat C/D visibility to RVR 4500. Simultaneous approach authorized with Rwy 17L and 17R. DME required.</p>	<p>MALSRR </p>	<p>MISSED APPROACH: Climb to 5900 then climbing right turn to 12000 on heading 218° and on FGF VORTAC R-254 to BREWS/FQF 26 DME and hold.</p>			
<p>D-ATIS ARR 125.6 379.9 DEF 134.025</p>	<p>DENVER APP CON 119.3 307.3 120.35 379.3 (NORTH) (SOUTH)</p>	<p>DENVER TOWER 135.3 351.95</p>	<p>GND CON 127.5 379.175</p>	<p>CLNC DEL 118.75</p>	<p>CPDLC</p>

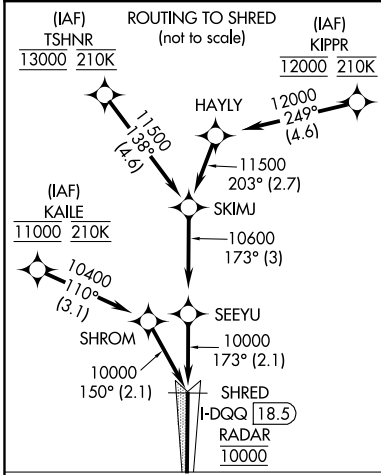

RADAR or GPS REQUIRED

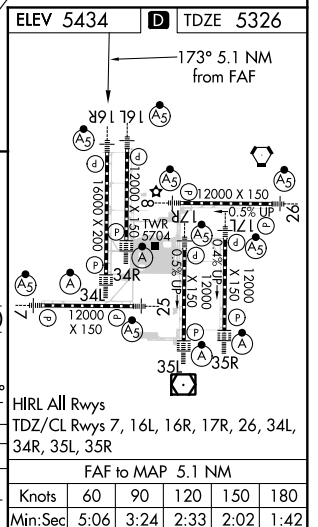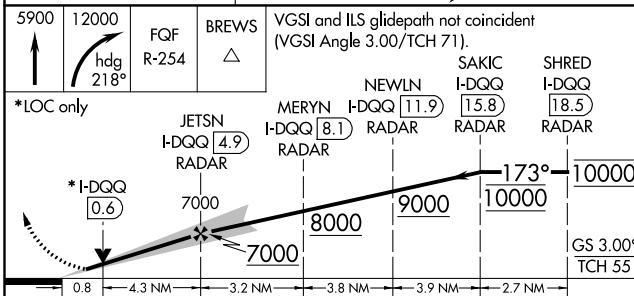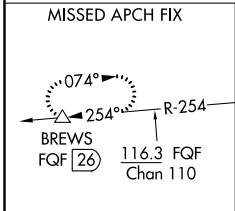

CATEGORY	A	B	C	D
S-ILS 16R	5526/18 200 (100-½)			
S-LOC 16R	5640/24 314 (300-½)			