


LOC/DME I-BXP 110.15 Chan 38 (Y)	APP CRS 173°	Rwy Idg 12000 TDZE 5339 Apt Elev 5434
--	------------------------	--

ILS or LOC RWY 17L





DENVER INTL (DEN)

▼ For inoperative MALSR, increase S-LOC Cats C/D visibility to RVR 4500. S-LOC 17L DME or RADAR required. Simultaneous approaches authorized with Rwy 17R and 16L/16R.
#RVR 1800 authorized with the use of FD or AP or HUD to DA.


MALSR 

MISSED APPROACH: Climb to 5900 then climbing left turn to 10000 on heading 120° and FQF VORTAC R-078 to LIMEX INT/FQF 31.9 DME and hold.


D-ATIS ARR 125.6 379.9 DEP 134.025	DENVER APP CON 119.3 307.3 (NORTH) 120.35 379.3 (SOUTH)	DENVER TOWER 132.35 239.275	GND CON 121.85 377.1	CLNC DEL 118.75	CPDLC
--	---	---------------------------------------	--------------------------------	---------------------------	-------

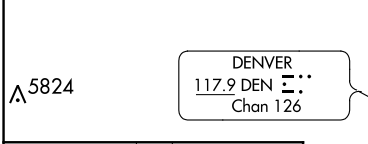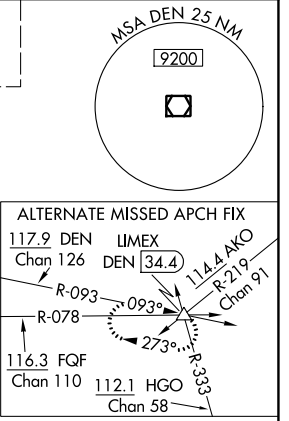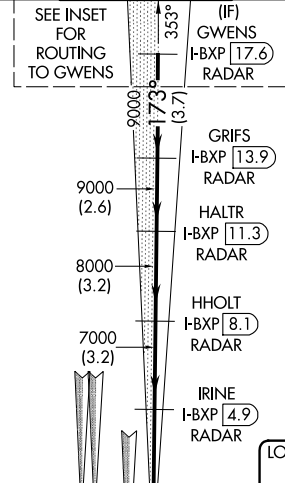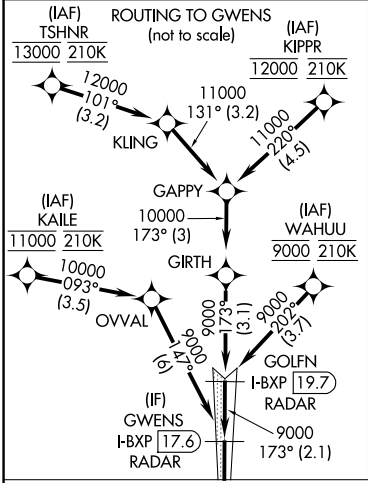


LOCALIZER 110.15 I-BXP Chan 38 (Y)

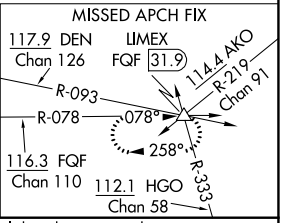

ELEV 5434	D	TDZE 5339
-----------	---	-----------

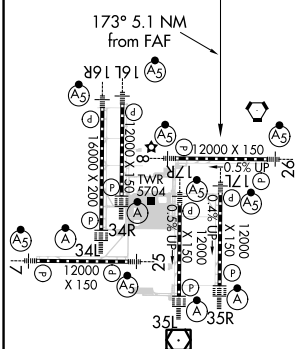

RADAR or GPS REQUIRED

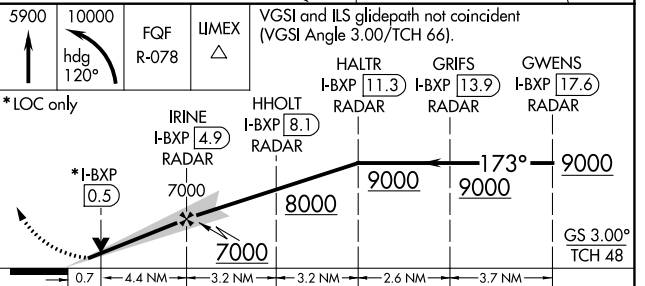

CATEGORY	A	B	C	D
S-ILS 17L	# 5539/24 200 (200-½)			
S-LOC 17L	5620/24 281 (200-½)			

SW-1, 25 MAR 2021 to 22 APR 2021

SW-1, 25 MAR 2021 to 22 APR 2021