


25163


ILS Y RWY 29R (CAT II & III)
FRESNO YOSEMITE INTL (FAT)

MISSED APPROACH: Climb to 800 then climbing right turn to 5500 on heading 330° and FRA VORTAC R-222 to NIVEE INT/FRA 8 DME and hold, continue climb-in-hold to 5500.

Page 10 of 10

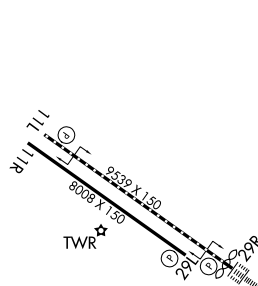

REIL Rwy 11L and 11R
HIRL Rwy 11L-29R
MIRL Rwy 11R-29L
TDZ/CL Rwy 29R

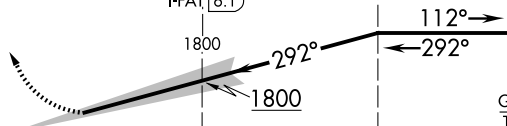800 ↑	5500 hdg 330°	FRA R-222	NIVEE INT	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 76).		SANGO INT I-FAT 12.6	One Minute Holding Pattern
				112° → 6000 ← 292° 2800		GS 3.00° TCH 55	
CATEGORY	A	B	C	D			
S-ILS 29R	CAT II RA 101/12 100 DA 433						
S-ILS 29R	CAT III RVR 06						

CATEGORY II & III ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

FRESNO YOSEMITE INTL (FAT)
ILS Y RWY 29R (CAT II & III)