
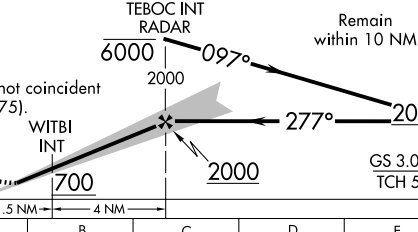




ILS Y or LOC RWY 28  
MONTGOMERY RGNL (DANNELLY FLD) (MGM)

**MISSED APPROACH:** Climb to 700 then climbing left turn to 3000 direct MGM VORTAC and hold, continue climb-in-hold to 3000 (TACAN aircraft continue climb to 3500 on MGM VORTAC R-126 to SHADY/MGM 15 DME and hold SE, RT, 306° inbound).

700 ↑	3000 ↖	MGM 	 <p>VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 75).</p> <p>TBOC INT RADAR 6000 2000 097° 277° 2000 GS 3.00° TCH 56</p> <p>WITBI INT 700 1.5 NM 4 NM</p> <p>Remain within 10 NM</p>				
CATEGORY	A	B	C	D	E		
S-ILS 28	397-1/2 200 (200-1/2)						
S-LOC 28	700-1/2	503 (500-1/2)	700-1 503 (500-1)				
 CIRCLING	700-1	468 (500-1)	800-1 1/2 568 (600-1 1/2)	860-2 628 (700-2)	860-2 1/4 628 (700-2 1/4)		
WITBI FIX MINIMUMS (DUAL VOR RECEIVERS REQUIRED)							
S-LOC 28	620-1/2	423 (400-1/2)	620-3/4 423 (400-3/4)				
 CIRCLING	700-1	468 (500-1)	800-1 1/2 568 (600-1 1/2)	860-2 628 (700-2)	860-2 1/4 628 (700-2 1/4)		