




LOC I-SAV <b>111.35</b>	APP CRS <b>097°</b>	Rwy Ldg TDZE <b>30</b>
Chan <b>50</b> (Y)		Apt Elev <b>50</b>

ILS RWY 10 (SA CAT I & II)  
SAVANNAH/HILTON HEAD INTL (SAV)

DME required.			MALSR	MISSED APPROACH: Climb to 800 then climbing left turn to 4000 on heading 330° and SAV VORTAC R-001 to TILLS INT/SAV 20 DME and hold.	
SA CAT I: Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD to DH. SA CAT II: Reduced lighting: Requires specific OPSPEC, MSPEC, or LOA approval and use of autoland or HUD to touchdown. Procedure NA when tower closed.					
ATIS <b>123.75</b>	SAVANNAH APP CON★ <b>125.3 371.875</b>	SAVANNAH TOWER★ <b>125.975</b> (CTAF) <b>257.8</b>	GND CON <b>121.9 348.6</b>	CLNC DEL <b>119.55 291.775</b>	UNICOM <b>122.95</b>

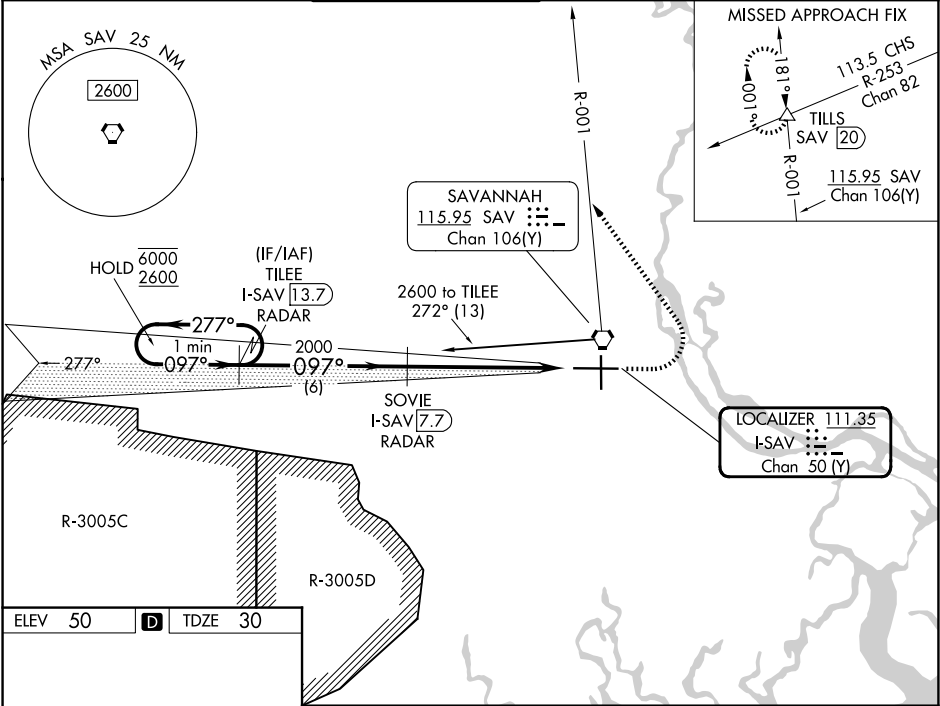

ELEV <b>50</b>	<b>D</b>	TDZE <b>30</b>
----------------	----------	----------------

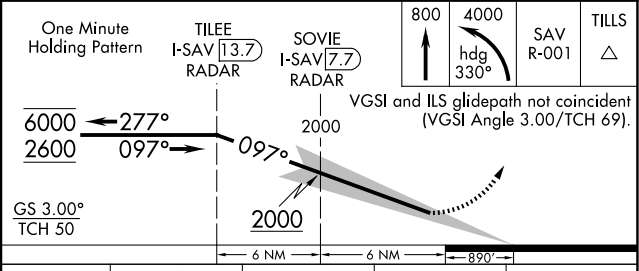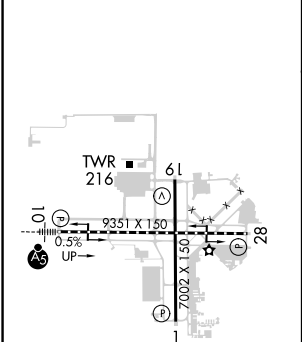

CATEGORY	A	B	C	D
S-ILS 10	SA CAT I	RA 162/14	150 DA 180	
S-ILS 10	SA CAT II	RA 116/12	100 DA 130	

SA CATEGORY I & II ILS - SPECIAL AIRCREW  
& AIRCRAFT CERTIFICATION REQUIRED