
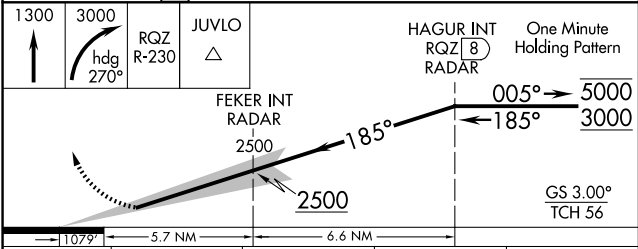


LOC I-HSV 109.3	APP CRS 185°	Rwy Ldg 12600 TDZE 629 Apt Elev 629	ILS RWY 18R (CAT II) HUNTSVILLE INTL-CARL T JONES FLD (HSV)
---------------------------	------------------------	--	---

DME required. RADAR required for procedure entry.	ALSIF-2	MISSED APPROACH: Climb to 1300 then climbing right turn to 3000 on heading 270° and RQZ R-230 to JUVLO/RQZ 28.7 DME and hold.
Simultaneous approach authorized. DME from RQZ VORTAC. DME use requires simultaneous reception of I-HSV and RQZ DME.		
ASR		

ATIS 121.25	HUNTSVILLE APP CON ★ 125.6 354.1	HUNTSVILLE TOWER ★ 127.6 (CTAF) 350.35	GND CON 121.9 269.525	CLNC DEL 120.35	UNICOM 122.95
-----------------------	--	--	---------------------------------	---------------------------	-------------------------

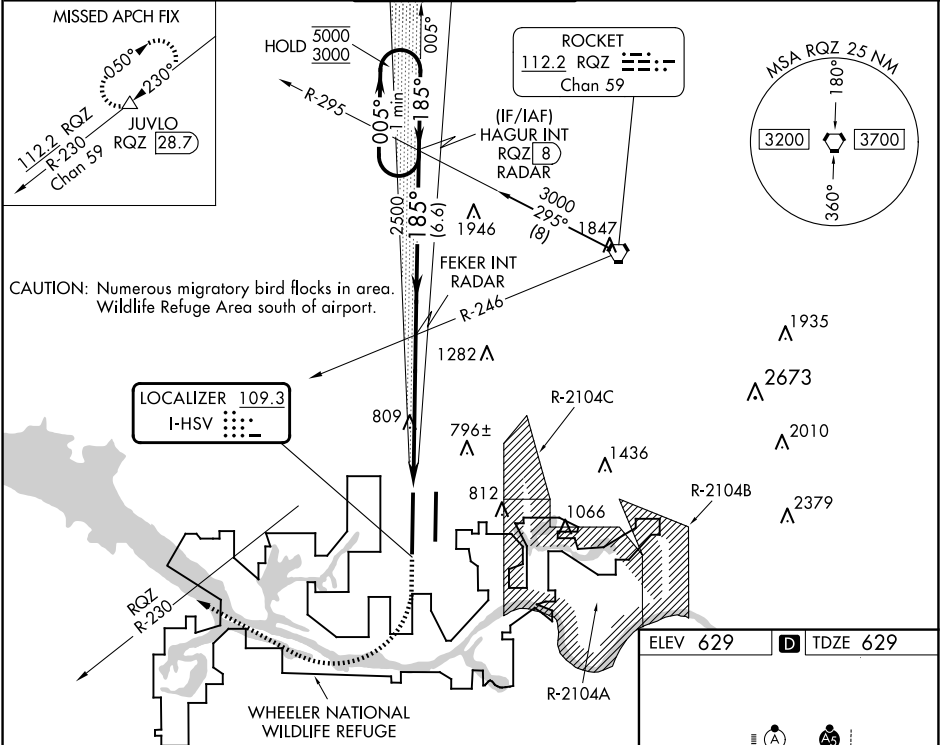

CATEGORY	A	B	C	D
S-ILS 18R				
	RA 105/12 100 DA 729			

CATEGORY II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

