

TAMPA, FLORIDA

AL-416 (FAA)

25163

LOC/DME I-TPA	APP CRS	Rwy Ldg	8300
110.3	187°	TDZE	26
Chan 40		Apt Elev	26

ILS RWY 19L (CAT II)
TAMPA INTL (TPA)


RADAR required for procedure entry.

Simultaneous approach authorized.
RVR 1000 authorized with specific OPSPEC, MSPEC, or
LOA approval and use of autoland or HUD to touchdown.



ALSIF-2

MISSED APPROACH: Climb to 600 then climbing left
turn to 4000 on heading 160° and on PIE VORTAC
R-138 to GIBBS INT and hold.

ARR	D-ATIS	DEP	TAMPA APP CON	TAMPA TOWER	GND CON	CLNC DEL	CPDLC
126.45		128.475	118.5 307.175	119.5 269.4	121.7 269.4	133.6	

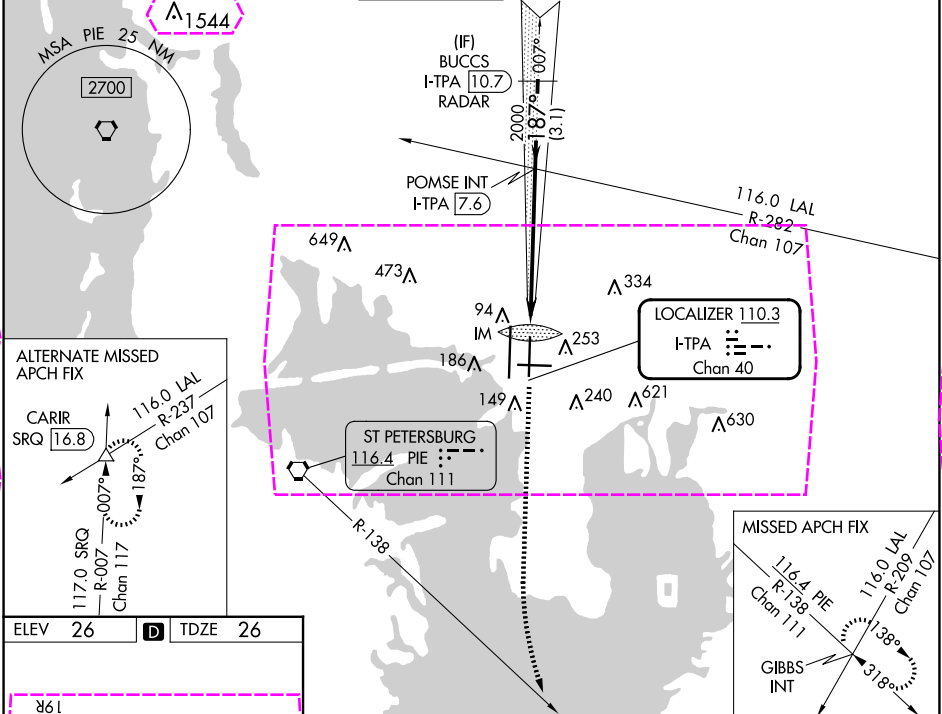

ELEV	26	D	TDZE	26
------	----	---	------	----

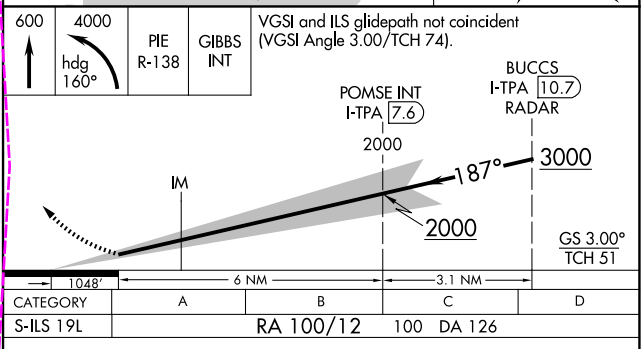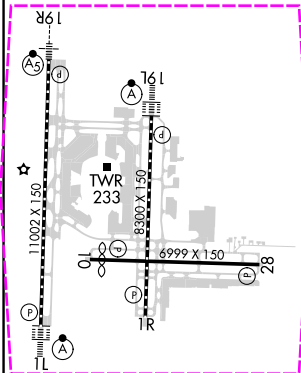

CATEGORY II ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

ILS RWY 19L (CAT II)

SE-3, 07 AUG 2025 to 04 SEP 2025