

WENDOVER, UTAH

AL-445 (FAA)

25163


WAAS CH 42523 W08A	APP CRS 078°	Rwy Ldg TDZE 4230 Apt Elev 4237
--	------------------------	---

RNAV (GPS) RWY 8


WENDOVER (ENV)

NA 13°C	Baro-VNAV NA. DME/DME RNP-0.3 NA.	MISSED APPROACH: Climb to 9000 direct BVL VORTAC and hold, continue climb-in-hold to 9000.
-------------------	-----------------------------------	--

AWOS-3PT 120.55	SALT LAKE CENTER 128.55 269.175	UNICOM 122.8 (CTAF)
---------------------------	---	-------------------------------

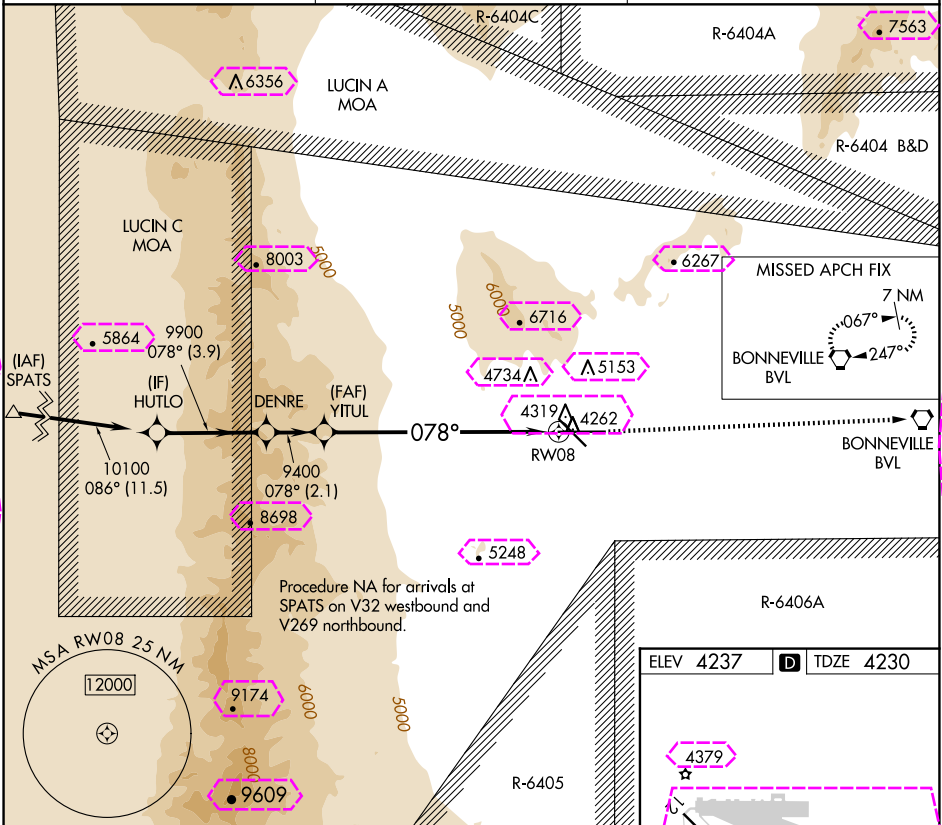

HUTLO	10100	078°	DENRE	9900	9400	YITUL	9400	8.5 NM	RW08
VGSi and RNAV glidepath not coincident (VGSi Angle 3.00/TCH 40).									
GP 5.68° TCH 60									
3.9 NM 2.1 NM									
CATEGORY	A		B		C		D		
LPV DA	4560-1 330 (400-1)				NA				
RNAV/VNAV DA	4581-1 351 (400-1)				NA				

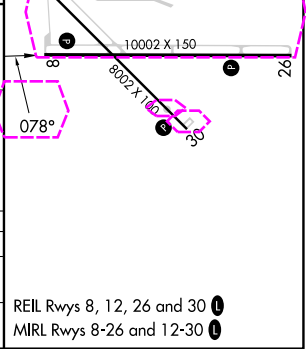

WENDOVER, UTAH
Amdt 1 08JAN15

40°43'N-114°02'W

WENDOVER (ENV)

RNAV (GPS) RWY 8

REIL Rwy 8, 12, 26 and 30
MIRL Rwy 8-26 and 12-30

WENDOVER, UTAH

AL-445 (FAA)


25219

WAAS CH 42523 W08A	APP CRS 078°	Rwy Ldg TDZE 4230 Apt Elev 4237
--	------------------------	---


RNAV (GPS) RWY 8 WENDOVER (ENV)

NA Baro-VNAV NA. DME/DME RNP-0.3 NA.	MISSED APPROACH: Climb to 9000 direct BVL VORTAC and hold, continue climb-in-hold to 9000.
--	--

AWOS-3PT 120.55	SALT LAKE CENTER 128.55 269.175	UNICOM 122.8 (CTAF)
---------------------------	---	-------------------------------

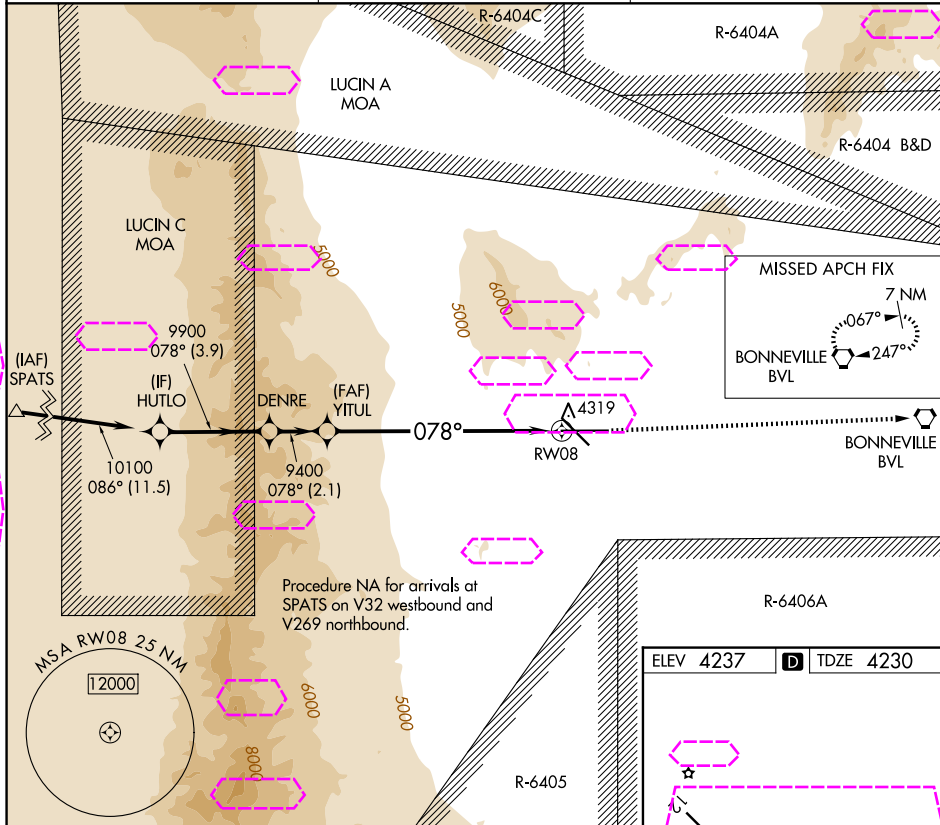

HUTLO		VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 40).			9000	BVL
10100		DENRE	YITUL			
078°		9900	9400			
GP 5.68° TCH 60						RW08
		3.9 NM	2.1 NM	8.5 NM		
CATEGORY	A	B	C	D		
LPV DA	4560-1 330 (400-1)		NA			
LNAV/ VNAV DA	4581-1 351 (400-1)		NA			

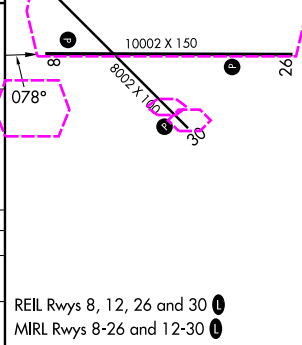

WENDOVER, UTAH
Amdt 1 08JAN15

40°43'N 114°02'W

WENDOVER (ENV)

RNAV (GPS) RWY 8

SW-4, 07 AUG 2025 to 04 SEP 2025

SW-4, 07 AUG 2025 to 04 SEP 2025