


BALTIMORE/WASHINGTON INTL THURGOOD MARSHALL (BWI)



MISSED APPROACH:
Climb to 2500 on track
105° to HURTZ and hold.

CLNC DEL
118.05

CPDLC

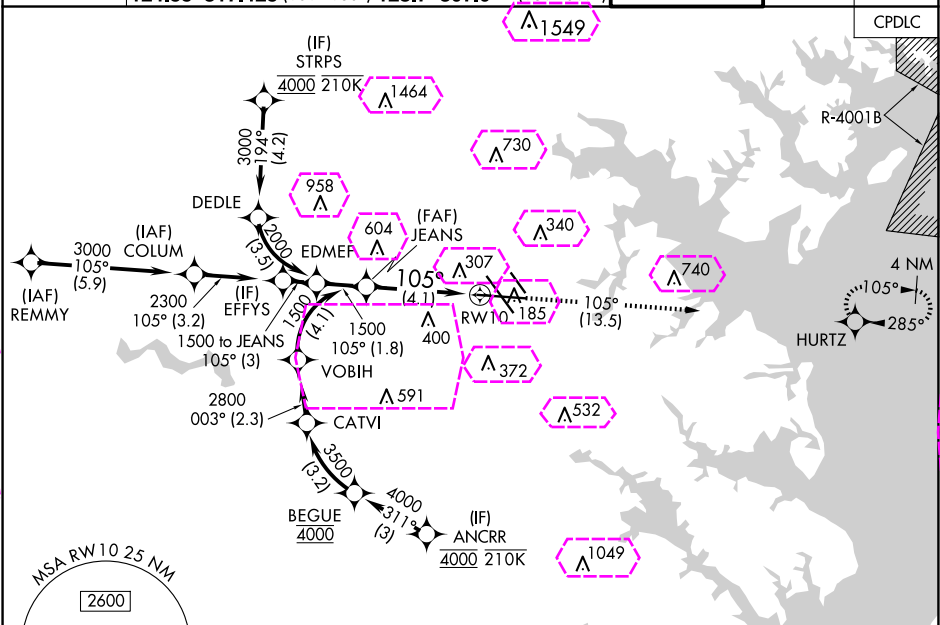

ELEV 143	D	TDZE 143
----------	----------	----------

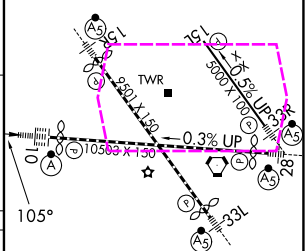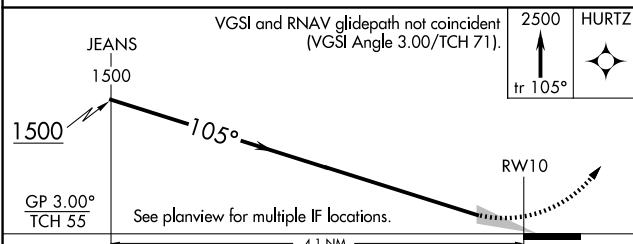

CATEGORY	A	B	C	D
RNP 0.11 DA	444/24 301 (400-½)			
RNP 0.30 DA	628/50 485 (500-1)			

AUTHORIZATION REQUIRED

TDZ/CL Rwy 10 and 33L
REIL Rwy 15L and 33R
HIRL all Rwy



RNAV (RNP) Z RWY 10

BALTIMORE/WASHINGTON INTL THURGOOD MARSHALL (BWI)

MISSED APPROACH:
Climb to 2500 on track
105° to HURTZ and hold.


CLNC DEL
118.05

CPDLC

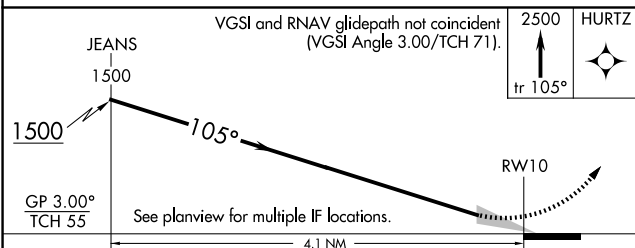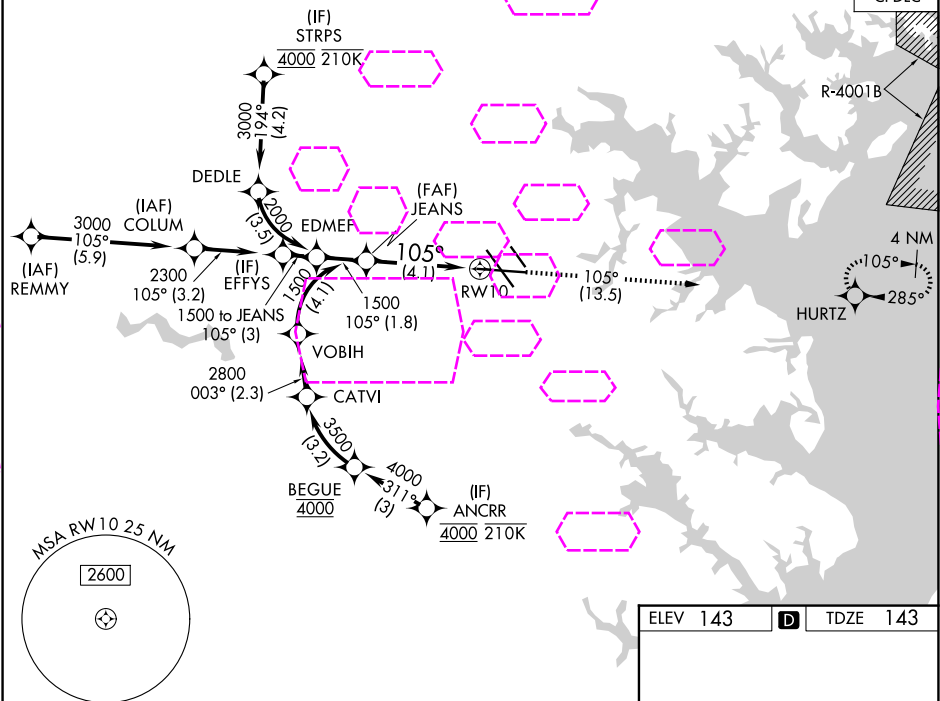

CATEGORY	A	B	C	D
RNP 0.11 DA		444/24	301 (400-½)	
RNP 0.30 DA		628/50	485 (500-1)	

AUTHORIZATION REQUIRED

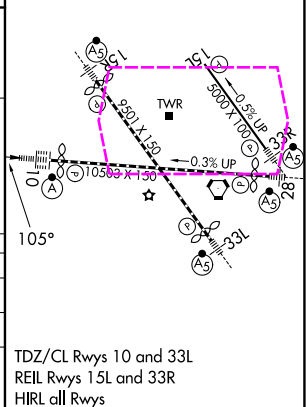

RNAV (RNP) Z RWY 10