

**SCOTT CITY MUNI** (TQK)(KTQK) 1 SE UTC-6(-5DT) N38°28.50' W100°53.07'

WICHITA

2969 B NOTAM FILE ICT

L-10G

**RWY 17-35:** H5002X75 (CONC) S-30, D-45 PCN 11 R/C/X/U MIRL

IAP

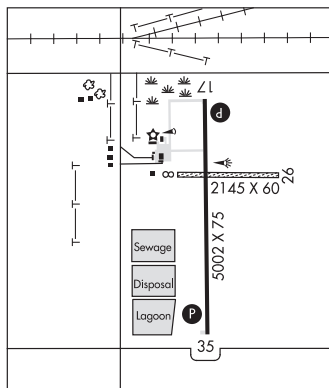
**RWY 17:** REIL. PAPI(P2L)—GA 3.0° TCH 38'. Road.**RWY 35:** REIL. PAPI(P2L)—GA 3.0° TCH 38'. Road.**RWY 08-26:** 2145X60 (TURF) 0.4% up E**SERVICE:** S4 FUEL 100LL, JET A LGT MIRL Rwy 17-35 preset low ints, to increase ints and ACTIVATE REIL Rwy 17-35, PAPI Rwy 17 and Rwy 35—CTAF.**AIRPORT REMARKS:** Attended 1400-2330Z†. Numerous birds invof airport. Rwy 08-26 sfc rough, with multiple rodent holes. Rwy 08-26 marked with painted tires. Pub telephone avbl 24 hrs 620-872-5378.**AIRPORT MANAGER:** (620) 872-5620**WEATHER DATA SOURCES:** AWOS-3P 120.00 (620) 872-2233. SAWRS.**COMMUNICATIONS:** CTAF/UNICOM 122.8

Ⓡ DENVER CENTER APP/DEP CON 132.7

**CLEARANCE DELIVERY PHONE:** For CD ctc Denver ARTCC at 303-651-4257.**RADIO AIDS TO NAVIGATION:** NOTAM FILE GCK.**GARDEN CITY (VH) (H) VORTACW** 113.3 GCK Chan 80 N37°55.14' W100°43.50' 336° 34.2 NM to fld. 2878/11E.**TACAN AZIMUTH unusable:**

280°-010° blo 4,000'

280°-010° byd 11 NM

**SEDAN CITY** (61K) 2 N UTC-6(-5DT) N37°08.90' W96°11.12'

KANSAS CITY

1005 NOTAM FILE ICT

**RWY 18-36:** 3160X81 (TURF) LIRL**RWY 18:** Trees.**RWY 36:** Trees.**RWY 12-30:** 1790X95 (TURF)**RWY 12:** Fence.**RWY 30:** Trees.**SERVICE:** LGT ACTIVATE LIRL Rwy 18-36—CTAF.**AIRPORT REMARKS:** Unattended. Wildlife and livestock in the vicinity and possibly on the rwy. Rwy 12 road 20' from rwy end, p-line at 450'.**AIRPORT MANAGER:** (620) 550-1195**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Kansas City ARTCC at 913-254-8508.**SENECA MUNI** (62K) 3 W UTC-6(-5DT) N39°50.86' W96°07.02'

KANSAS CITY

1291 NOTAM FILE ICT

**RWY 18-36:** 2400X100 (TURF) LIRL(NSTD) 0.9% up N**RWY 18:** Fence.**RWY 36:** Trees.**SERVICE:** LGT Rwy 18-36 NSTD LIRL, spacing more than 200' apart, rwy end lgts orange, AER 18 has only 3 rwy end lgts.**AIRPORT REMARKS:** Unattended. Ultralight activity on and invof arpt. Call 785-336-2141 for arpt access. Rwy 18-36 N 1050' rough to intersection with twy. Rwy 36 3.5% incline first 1,000'; remainder 2% incline. Fence AER 18 marked with white reflectors.**AIRPORT MANAGER:** 785-336-3537**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Kansas City ARTCC at 913-254-8508.**SHALZ FLD** (See COLBY on page 93)