

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE FKN.**FRANKLIN (L) (L) VORTACW** 110.6 FKN Chan 43 N36°42.85' W77°00.74' 104° 20.0 NM to fld. 84/9W.

VOR unusable:

090°–119° byd 18 NM blo 2,000'

119°–128° byd 10 NM

129°–134° byd 33 NM

135°–148°

TACAN AZIMUTH unusable:

090°–139°

DME unusable:

090°–139°

LOC/DME 109.95 I–RKH Chan 36(Y) Rwy 04.**TANGIER ISLAND (TGI)(KTGI)** 1 W UTC–5(–4DT) N37°49.55' W75°59.86'

5 B TPA—See Remarks NOTAM FILE DCA

RWY 02–20: H2426X75 (ASPH) S–12.5**RWY 02:** Tree. Rgt tfc.**RWY 20:** Thld dsplcd 183'. Road.**SERVICE:** LGT Arpt bcn OTS indef.

AIRPORT REMARKS: Attended Apr–Oct Sat–Sun 1300–2130Z†. Arpt closed SS–SR daily. Be alert: rstd area one mi west of arpt; hi–speed acft drop bombs & fire live ammunition in area. PAEW adjacent to all rwys, twys & ramps. TPA—605(600) lgt acft, 1505(1500) hvy acft. Rwy end 02: prev rwy nrs vsb on former rwy pavement. Chevrons on former rwy pavement poor. Rwy centerline poor. Rwy end 20: twy lead–in lines poor. Rwy centerline poor. Landing/parking fee to help pay for rwy rehab. Ldg fee.

AIRPORT MANAGER: 757–891–2496**WEATHER DATA SOURCES:** AWOS–3 119.8 (757) 891–2246.**COMMUNICATIONS:** CTAF/UNICOM 122.8

Ⓡ **PATUXENT APP/DEP CON** 121.0 (1200–0400Z† Mon–Sun. Other times by NOTAM) other times ctc

Ⓡ **POTOMAC APP/DEP CON** 127.2

CLEARANCE DELIVERY PHONE: For CD ctc Patuxent Apch at 301–342–3740, when Patuxent Apch is clsd ctc Potomac Apch at 866–640–4124.

RADIO AIDS TO NAVIGATION: NOTAM FILE DCA.**CAPE CHARLES (L) (L) VORTACW** 112.2 CCV Chan 59 N37°20.85' W75°59.86' 010° 28.7 NM to fld. 10/10W.

TACAN AZIMUTH unusable:

005°–015° byd 20 NM blo 4,000'

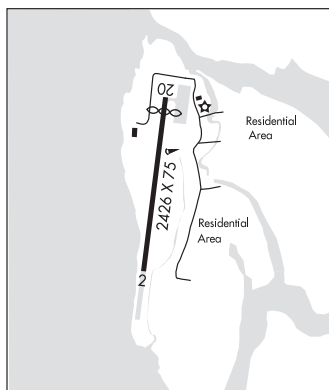
VOR unusable:

137°–322° byd 17 NM blo 2,000'

137°–322° byd 22 NM blo 3,000'

DME unusable:

005°–015° byd 20 NM blo 4,000'

WASHINGTON
L–34E, 36I
IAP**TAPPAHANNOCK/ESSEX CO (XSA)(KXSA)** 5 S UTC–5(–4DT) N37°51.58' W76°53.65'

135 B NOTAM FILE XSA

RWY 10–28: H4300X75 (ASPH) S–12.5 MIRL**RWY 10:** REIL. PAPI(P2L)—GA 3.0° TCH 40'. Trees.**RWY 28:** REIL. PAPI(P2L)—GA 3.0° TCH 40'. Trees.

SERVICE: S4 FUEL 100LL, JET A LGT ACTIVATE MIRL Rwy 10–28 and PAPI Rwy 10 and Rwy 28 and rotating bcn—CTAF.

AIRPORT REMARKS: Attended Nov–Feb 1300–2300Z†. Mar–Oct 1400–0000Z†. Deer and other wildlife on and invof arpt.

AIRPORT MANAGER: 804–443–5885**WEATHER DATA SOURCES:** AWOS–3 125.775 (804) 445–8724.**COMMUNICATIONS:** CTAF/UNICOM 122.8

Ⓡ **POTOMAC APP/DEP CON** 126.4

CLEARANCE DELIVERY PHONE: For CD ctc Potomac Apch at 866–640–4124.

RADIO AIDS TO NAVIGATION: NOTAM FILE RIC.**RICHMOND (H) (H) VORTACW** 114.1 RIC Chan 88 N37°30.14'

W77°19.22' 052° 29.5 NM to fld. 158/9W.

TAC AZM unusable:

060°–075° byd 10 NM blo 1,700'

WASHINGTON
L–34E, 36I
IAP