

Flight Procedures Cover Page	Task Action: Amendment	Task Type: IAP	Estimated Chart Date: 03/26/2020	APWS Task ID: 184A62E0B86B46EE8D88D2738A566AA6	APWS Request ID: E0D81783911D49D18AD28A2A9C1A2CB3
Procedure: ILS OR LOC RWY 29 AMDT 4D		Enroute: NO	Specialist: Dougherty, Steven		Agreement Number:
Airport ID: KORH	Airport Name: WORCESTER RGNL		Airport City: WORCESTER		State: MA
Facility ID: EKW	Facility Type: ILS	Flight Inspection Remark Type:			
<div>Procedure Comments: PROCESSED IAW AIRCRAFT OPERATIONS GROUP (AJW-33) MEMO, OCTOBER 3, 2018, SUBJECT: FLIGHT INSPECTION REVIEW NOT REQUIRED.</div> <div>P-NOTAM.</div> <div>DAVID DANNER, AJV-A421, 405-954-5077.</div> <div><div>QUALITY 31 vbn 01/13/19 CHECKED</div><div>QUALITY 26 CHECKED</div></div>					




LOC/DME F-EKW 110.9 Chan 46	APP CRS 289°	Rwy Idg 7001 TDZE 990 Apt Elev 1009
---	------------------------	--

ILS or LOC RWY 29
WORCESTER RGNL (ORH)

⚠ DME required. VDP NA with Bedford altimeter setting. When local altimeter setting not received, use Bedford altimeter setting and increase all DA 189 feet and all MDA 200 feet; increase S-ILS 29 all Cats visibility to 1¼, increase S-LOC 29 Cats C/D visibility to 1¾, and Circling Cat B to 1¼, Cat C to 2¾. Autopilot coupled approach NA below 1266 feet.

MISSED APPROACH: Climb to 1600 then climbing left turn to 3000 on heading 240° and on GDM VOR/DME R-179 to GRIPE/GDM 25.5 DME and hold.

ATIS 126.55	BRADLEY APP CON 119.0 327.1	WORCESTER TOWER★ 120.5 (CTAF) 0 263.0	GND CON 123.85	CLNC DEL 128.65 119.0 (when tower closed)	UNICOM 122.95
-----------------------	---------------------------------------	---	--------------------------	---	-------------------------

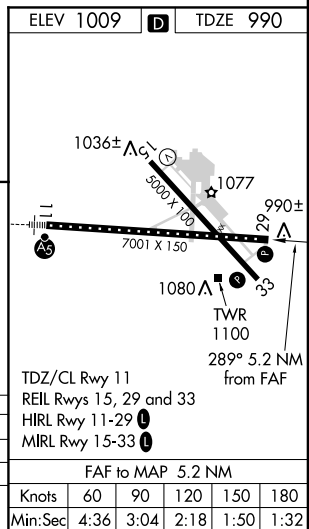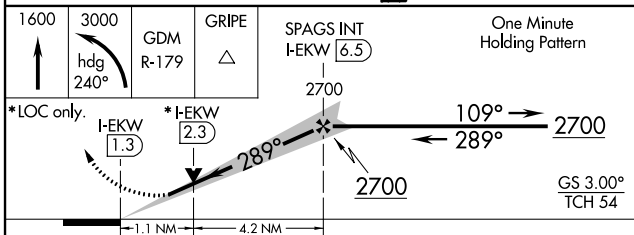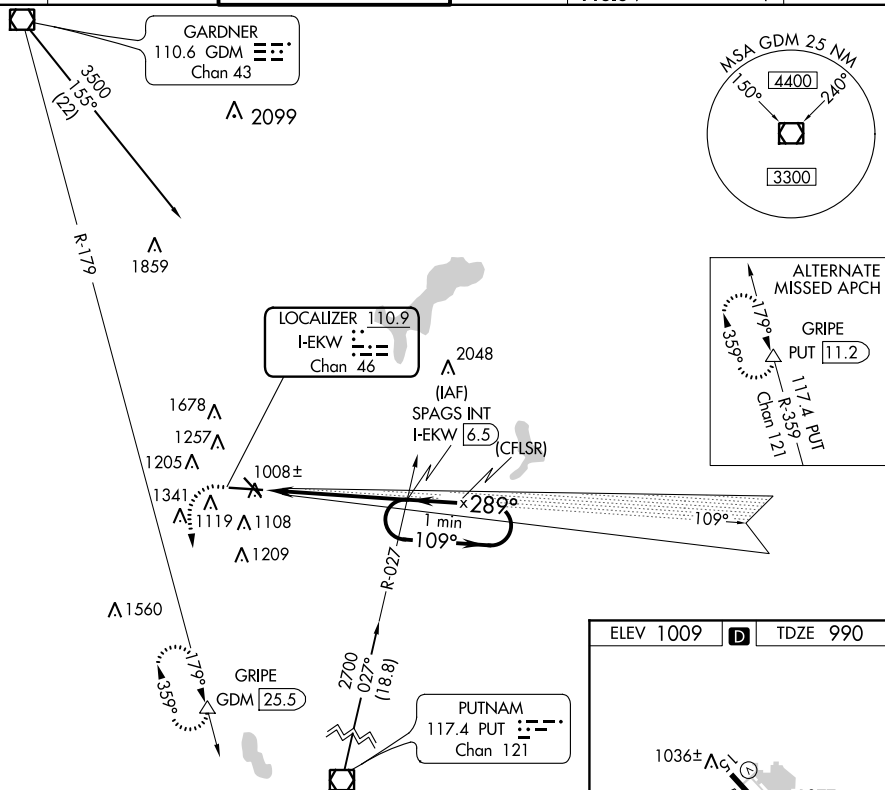

72°00'W

71°45'W

42°15'0"N

