

Flight Procedures Cover Page	Task Action: FLIGHT CHECK	Task Type: Textual DP	Estimated Chart Date: 12/29/2022	APWS Task ID: 3C3CCACACE654A1E9421DD89A9BEF525	APWS Project ID: 1AB7B4EDF709407E9CFDDBEFB39CAD68
Procedure: TAKEOFF MINIMUMS AND ODP AMDT 1		Enroute: NO	Specialist: Martinelli, Tara		Agreement Number:
Airport ID: KPLD			Airport City: PORTLAND		State: IN
Facility ID:	Facility Type:	Flight Inspection Remark Type: New FC Slot			
<p>Procedure Comments: RUNWAY EXTENTION/NEW SURVEY</p> <p>PENDING DATA USED FOR KPLD AIRPORT AND RUNWAYS</p> <p>CONTACT ERIC SUSKI: AJV-A431, 405-954-7331 12/05/22: THIS IS AN UPDATED COPY OF THE FORM DEVELOPED ON 07/29/2022. 8260-15A: 1. ADDED 02/23/2023 TO REQUIRED EFFECTIVE DATE. 2. ADDED PENDING TO FLIGHT INSPECTED BY SECTION.</p>					

QUALITY
48
CHECKED



22195

TAKEOFF MINIMUMS, (OBSTACLE) DEPARTURE PROCEDURES, AND

DIVERSE VECTOR AREA (RADAR VECTORS)



PORT CLINTON, OH

ERIE-OTTAWA INTL (PCW)

TAKEOFF MINIMUMS AND (OBSTACLE) DEPARTURE PROCEDURES

AMDT 6A 12NOV15 (15316) (FAA)

TAKEOFF MINIMUMS:

Rwy 27, std. w/ min. climb of 250' per NM to 1600 or 1000-2½ for climb in visual conditions.

DEPARTURE PROCEDURE:

Rwy 27, for climb in visual conditions: cross Carl R Keller Field at or above 1400 MSL before proceeding on course.

TAKEOFF OBSTACLE NOTES:

Rwy 9, multiple trees and poles beginning 417' from DER, 398' left of centerline, up to 78' AGL/668' MSL.

Multiple trees and poles beginning 407' from DER, 550' right of centerline, up to 67' AGL/657' MSL.

Rwy 18, multiple trees beginning 626' from DER, 424' left of centerline, up to 100' AGL/684' MSL.

Trees 511' from DER, 471' right of centerline, 100' AGL/684' MSL.

Vehicles on road 475' from DER, 31' right of centerline, 15' AGL/604' MSL.

Rwy 27, multiple trees beginning 1210' from DER, 176' left of centerline, up to 65' AGL/650' MSL.

Pole 1066' from DER, 609' right of centerline, 35' AGL/620' MSL.

Multiple trees beginning 2558' from DER, 311' right of centerline, up to 91' AGL/676' MSL.

Rwy 36, trees 558' from DER, 406' left of centerline, 100' AGL/684' MSL.

Trees 770' from DER, 564' right of centerline, 100' AGL/679' MSL.

Trees 5097' from DER, 1661' right of centerline, 100' AGL/719' MSL.

PORTLAND, IN

PORTLAND MUNI (PLD)

TAKEOFF MINIMUMS AND (OBSTACLE) DEPARTURE PROCEDURES

ORIG-A 22AUG13 (13234) (FAA)

TAKEOFF OBSTACLE NOTES:

Rwy 9, poles, trees and fence beginning 29' from DER, 348' right of centerline, up to 53' AGL/979' MSL.

Poles and trees beginning 102' from DER, 514' left of centerline, up to 51' AGL/972' MSL.

Trees and poles beginning 1026' from DER, 80' right of centerline, up to 71' AGL/994' MSL.

Trees and poles beginning 1036' from DER, 12' left of centerline, up to 46' AGL/972' MSL.

Trees beginning 2044' from DER, 47' right of centerline, up to 113' AGL/1035' MSL.

Trees beginning 2797' from DER, 15' left of centerline, up to 104' AGL/1027' MSL.

Rwy 27, Trees beginning 262' from DER, 317' left of centerline, up to 28' AGL/932' MSL.

Trees 293' from DER, 474' right of centerline, 16' AGL/922' MSL.

Building 1124' from DER, 617' right of centerline, 32' AGL/942' MSL.

PORTSMOUTH, OH

GREATER PORTSMOUTH RGNL (PMH)

TAKEOFF MINIMUMS AND (OBSTACLE) DEPARTURE PROCEDURES

AMDT 3 31MAY12 (12152) (FAA)

TAKEOFF MINIMUMS:

Rwy 18, 300-1¾ or std. w/min. climb of 257' per NM to 1100.

DEPARTURE PROCEDURE:

Rwy 18, climb heading 170° to 1300 before proceeding on course.

TAKEOFF OBSTACLE NOTES:

Rwy 18, trees beginning 4' from DER, 290' left of centerline, up to 100' AGL/721' MSL.

Trees beginning 678' from DER, 495' right of centerline, up to 100' AGL/931' MSL.

Rwy 36, trees beginning 1' from DER, 180' left of centerline, up to 100' AGL/780' MSL.

Trees beginning 687' from DER, 388' right of centerline, up to 100' AGL/710' MSL.

RAVENNA, OH

PORTAGE COUNTY (POV)

TAKEOFF MINIMUMS AND (OBSTACLE) DEPARTURE PROCEDURES

ORIG 18NOV10 (10322) (FAA)

TAKEOFF OBSTACLE NOTES:

Rwy 9, power poles and road 19' from DER, 368' left of centerline, up to 35' AGL/1238' MSL.

Power pole 413' from DER, 549' right of centerline, 35' AGL/1218' MSL.

Rwy 27, tree 751' from DER, 148' right of centerline, 56' AGL/1226' MSL.

Pole 105' from DER, 523' right of centerline, 35' AGL/1200' MSL.

Power poles 357' from DER, 408' left of centerline, up to 35' AGL/1244' MSL.

RENSSELAER, IN

JASPER COUNTY (RZL)

TAKEOFF MINIMUMS AND (OBSTACLE) DEPARTURE PROCEDURES

AMDT 1 14JAN88 (88014) (FAA)

TAKEOFF MINIMUMS:

Rwys 9, 18, 27, 36, 300-1.

DEPARTURE PROCEDURE:

Rwys 9, 18, 27, 36, climb to 1100 on runway heading before proceeding on course.



22195

TAKEOFF MINIMUMS, (OBSTACLE) DEPARTURE PROCEDURES, AND

DIVERSE VECTOR AREA (RADAR VECTORS)



EC-2


14 JUL 2022 to 11 AUG 2022

14 JUL 2022 to 11 AUG 2022

AIRPORT ID: KPLD
AIRPORT NAME: PORTLAND MUNI
CITY: PORTLAND
STATE: IN
PROCEDURE ID: TEXTUAL ODP - RWY9
SCALE: 1:500,000
MAP DATE: 07/18/2022



AIRPORT ID: KPLD
AIRPORT NAME: PORTLAND MUNI
CITY: PORTLAND
STATE: IN
PROCEDURE ID: TEXTUAL ODP - RWY9
SCALE: 1:100,000
MAP DATE: 07/18/2022

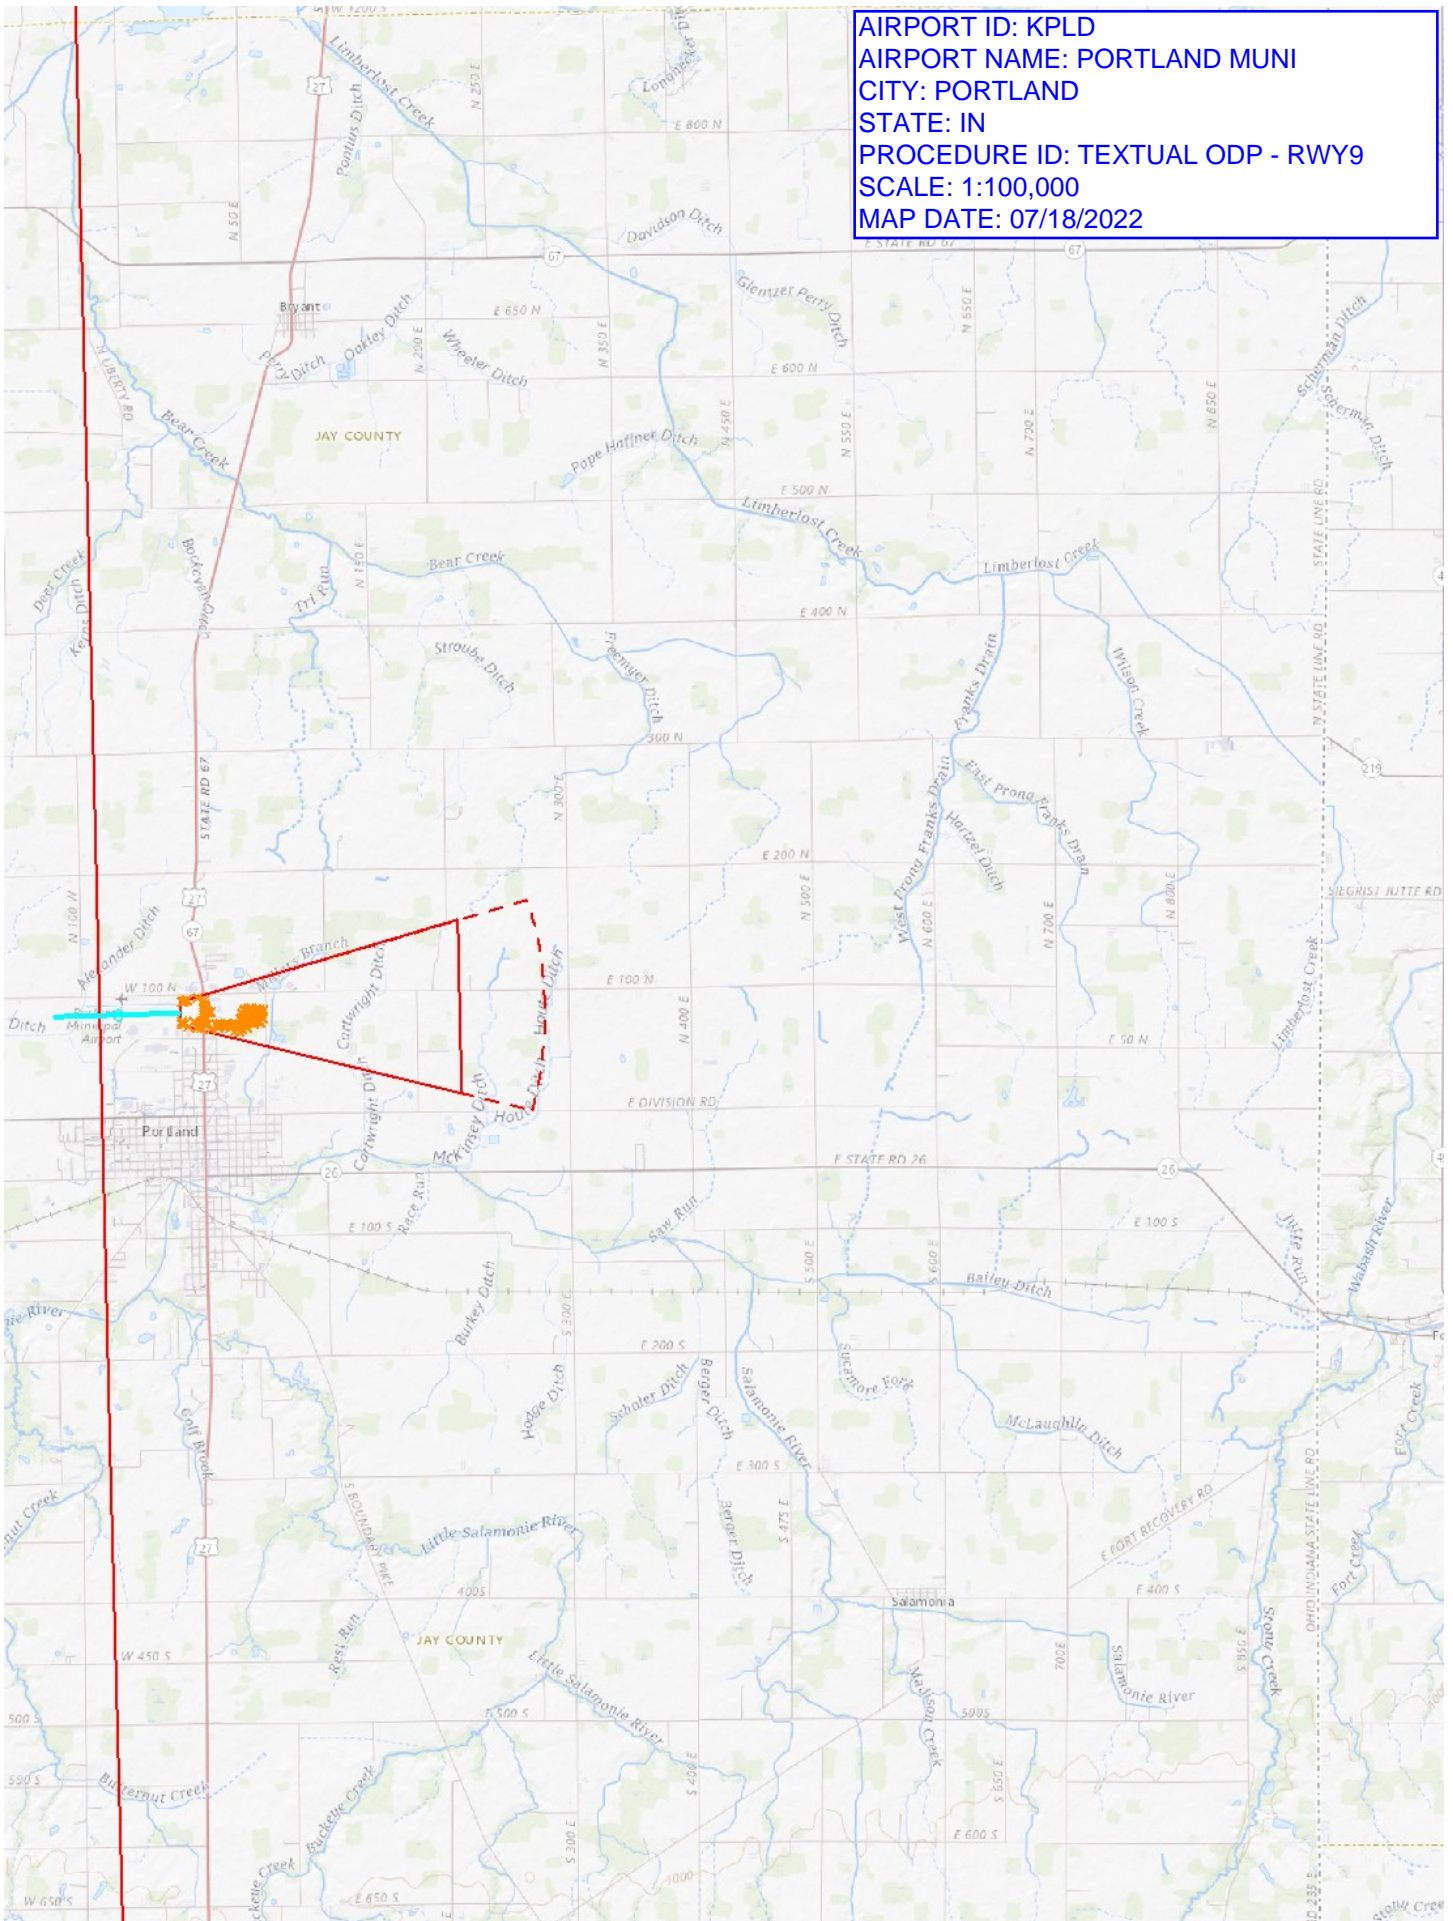

AIRPORT ID: KPLD
AIRPORT NAME: PORTLAND MUNI
CITY: PORTLAND
STATE: IN
PROCEDURE ID: TEXTUAL ODP - RWY27
SCALE: 1:500,000
MAP DATE: 07/18/2022



AIRPORT ID: KPLD
AIRPORT NAME: PORTLAND MUNI
CITY: PORTLAND
STATE: IN
PROCEDURE ID: TEXTUAL ODP - RWY27
SCALE: 1:100,000
MAP DATE: 07/18/2022

