

LOC/DME I-BEJ 110.75 Chan 44 (Y)	APP CRS 344°	Rwy ldg TDZE 8500 379 Apt Elev 433
---	------------------------	---




ILS RWY 34L (SA CAT I & II)

SEATTLE-TACOMA INTL (SEA)

▼ DME or RADAR required. Simultaneous approach authorized with Rwy 34R/C. SA CAT I: Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD to DH. SA CAT II: Reduced lighting, requires specific OPSPEC, MSPEC, or LOA approval and use of autoland or HUD to touchdown.

MALS R
MISSED APPROACH: Climb to 900 then climbing left turn on heading 300° and on SEA VORTAC R-310 to cross WEXUB/10 DME/RADAR at or above 3000, then climb to 5000 on SEA VORTAC R-310 to LOFAL/SEA 29.2 DME and hold.



D-ATIS 118.0	SEATTLE APP CON 133.65 273.45	SEATTLE TOWER 119.9 239.3 (Rwys 16L, 16C, 34C, 34R) 120.95 239.3 (Rwys 16R, 34L)	GND CON 121.7	CLNC DEL 128.0	CPDLC
------------------------	---	--	-------------------------	--------------------------	-------

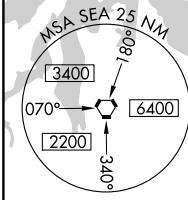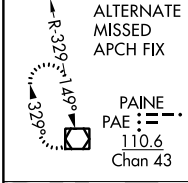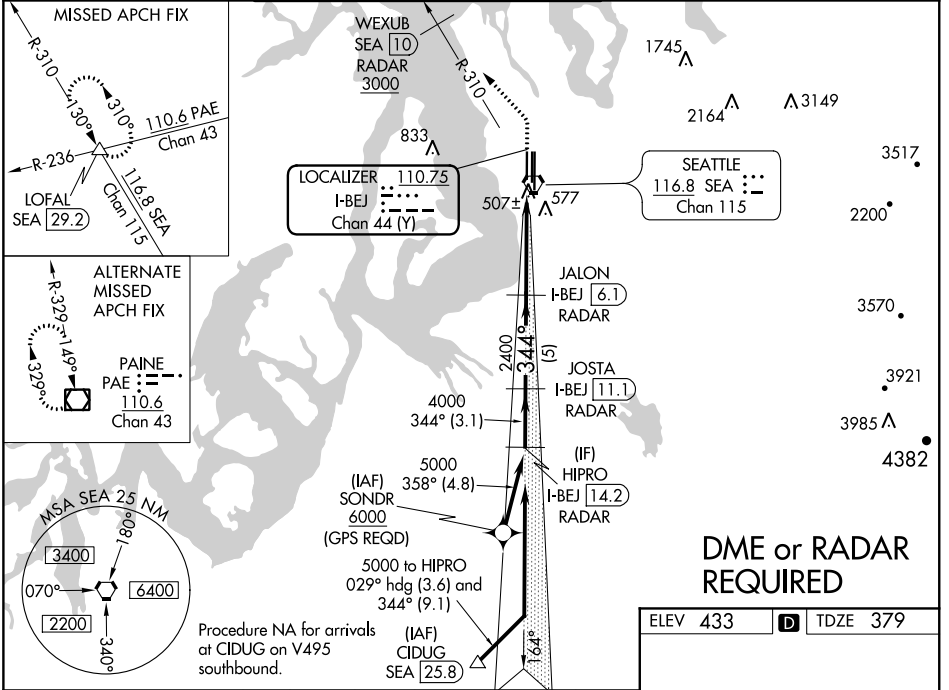

Procedure NA for arrivals at CIDUG on V495 southbound.

DME or RADAR REQUIRED

ELEV 433	D TDZE 379
----------	-------------------

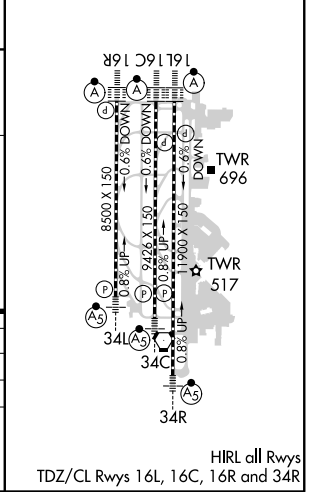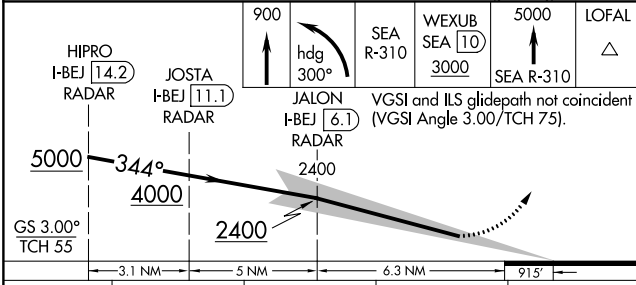

CATEGORY	A	B	C	D
S-ILS 34L	SA CAT I RA 213/14 150 DA 529			
S-ILS 34L	SA CAT II RA 117/12 100 DA 479			

SA CATEGORY I & II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

HIRL all Rwys
TDZ/CL Rwys 16L, 16C, 16R and 34R

NW-1, 15 AUG 2019 to 12 SEP 2019

NW-1, 15 AUG 2019 to 12 SEP 2019