


WAAS CH 53702 W36A	APP CRS 005°	Rwy Idg TDZE 764 Apt Elev 764
--	------------------------	---

RNAV (GPS) RWY 36

HUNTSVILLE EXECUTIVE TOM SHARP JR FIELD (MDQ)



RNP APCH.	MISSED APPROACH: Climb to 3400 direct EROVE and hold.
For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C.	

AWOS-3PT 120.0	HUNTSVILLE APP CON★ 125.6 354.1	GCO 121.725	UNICOM 123.0 (CTAF) 0
--------------------------	---	-----------------------	---------------------------------

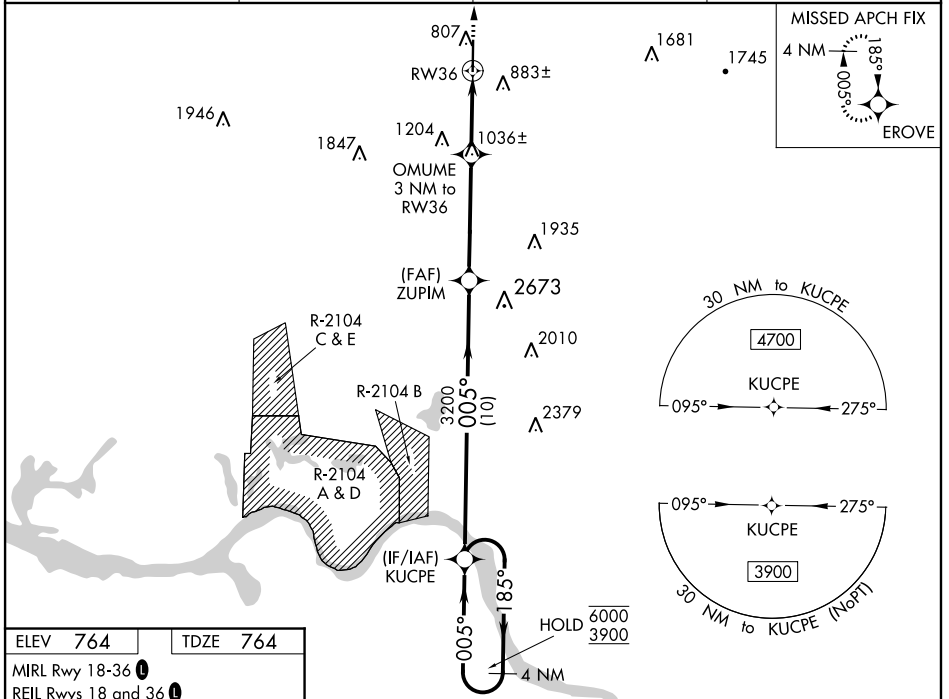

ELEV 764	TDZE 764
----------	----------

MIRL Rwy 18-36 REIL Rwy 18 and 36

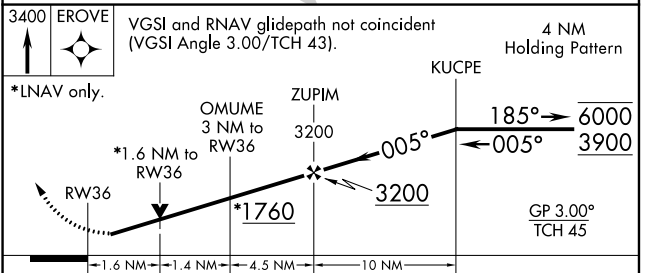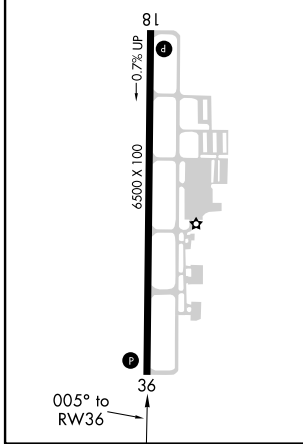

CATEGORY	A	B	C	D
LPV DA		964-3/4	200 (200-3/4)	
LNAV/VNAV DA		1250-1 5/8	486 (500-1 5/8)	
LNAV MDA	1300-1	536 (600-1)	1300-1 1/2	536 (600-1 1/2)
CIRCLING	1300-1	536 (600-1)	1560-2 1/4	2000-3
			796 (800-2 1/4)	1236 (1300-3)

SE-4, 13 AUG 2020 to 10 SEP 2020

SE-4, 13 AUG 2020 to 10 SEP 2020