

LOC/DME I-PLJ 111.35 Chan 50 (Y)	APP CRS 273°	Rwy Idg TDZE Apt Elev	8002 8 8
--	------------------------	-----------------------------	-------------------------------------

ILS or LOC RWY 27R
MIAMI-OPA LOCKA EXECUTIVE (OPF)

⚠ DME Required. When local altimeter setting not received, use Miami Intl altimeter setting and increase all DA/MDA 20 feet. For inop MALS, increase S-ILS 27R all Cats visibility to 7/8 mile and S-LOC Cats C/D visibility to 1/8 mile. Helicopter visibility reduction below 3/4 SM NA. Autopilot coupled approach NA below 700 feet.

MALS




MISSED APPROACH: Climb to 2000 heading 273° and DHP VORTAC R-335 to BRBRA/DHP 11.5 DME and hold.

ATIS 125.9	MIAMI APP CON 128.6 306.975	OPA LOCKA TOWER ★ 134.675 (CTAF)	GND CON 120.025	CLNC DEL 119.2
----------------------	---------------------------------------	--	---------------------------	--------------------------

RADAR REQUIRED



ALTERNATE MISSED APCH FIX

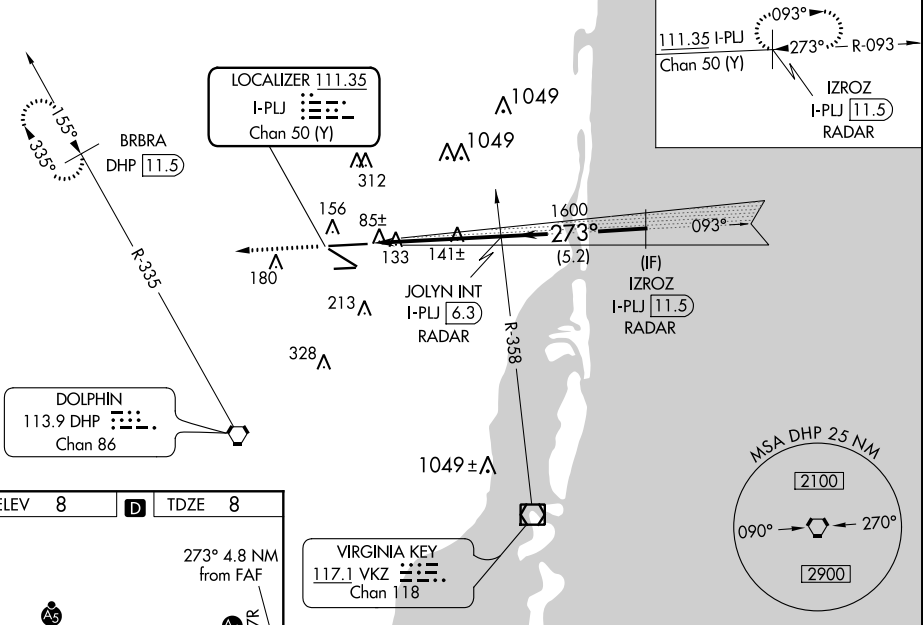

SE-3, 10 SEP 2020 to 08 OCT 2020

SE-3, 10 SEP 2020 to 08 OCT 2020

ELEV 8	D	TDZE 8
---------------	----------	---------------

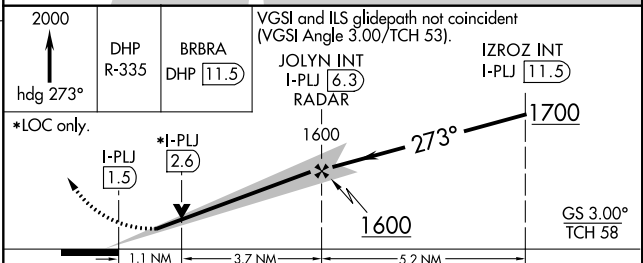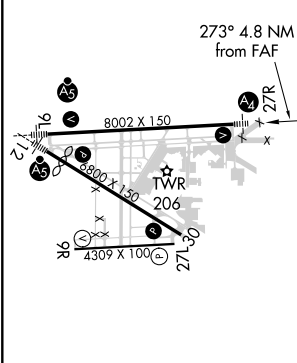

MIRL Rwy 9R-27L HIRL Rwys 9L-27R and 12-30				
FAF to MAP 4.8 NM				
Knots	60	90	120	150
Min:Sec	4:48	3:12	2:24	1:55
CIRCLING	540-1	532 (600-1)	420-1	412 (500-1)
			540-1 1/2	560-2
			532 (600-1 1/2)	552 (600-2)