

MARYSVILLE, CALIFORNIA

HI-ILS or LOC Z RWY 15

LOC I-BAB 109.5	APCH CRS 145°	Rwy ldg 12,001	TDZE 113
		Arpt Elev 113	

JAL-771 (USAF)


BEALE AFB (KBAB)

* When ALS inop, increase CAT CDE RVR to 40 and vis to 3/4 mile.
 ** When ALS inop, increase CAT CDE vis to 1 3/8 miles.
 *** Circling not authorized E of Rwy 15-33.



MISSED APPROACH: Climb to 4400 direct to BAB TACAN. Turn right to intercept BAB R-326 to HAPAK and hold, continue climb in hold to 4400.

ATIS* 124.55 273.5	NORCAL APP CON 125.4 259.1	TOWER* 119.4 284.75	GND CON 121.6 257.75
------------------------------	--------------------------------------	-------------------------------	--------------------------------

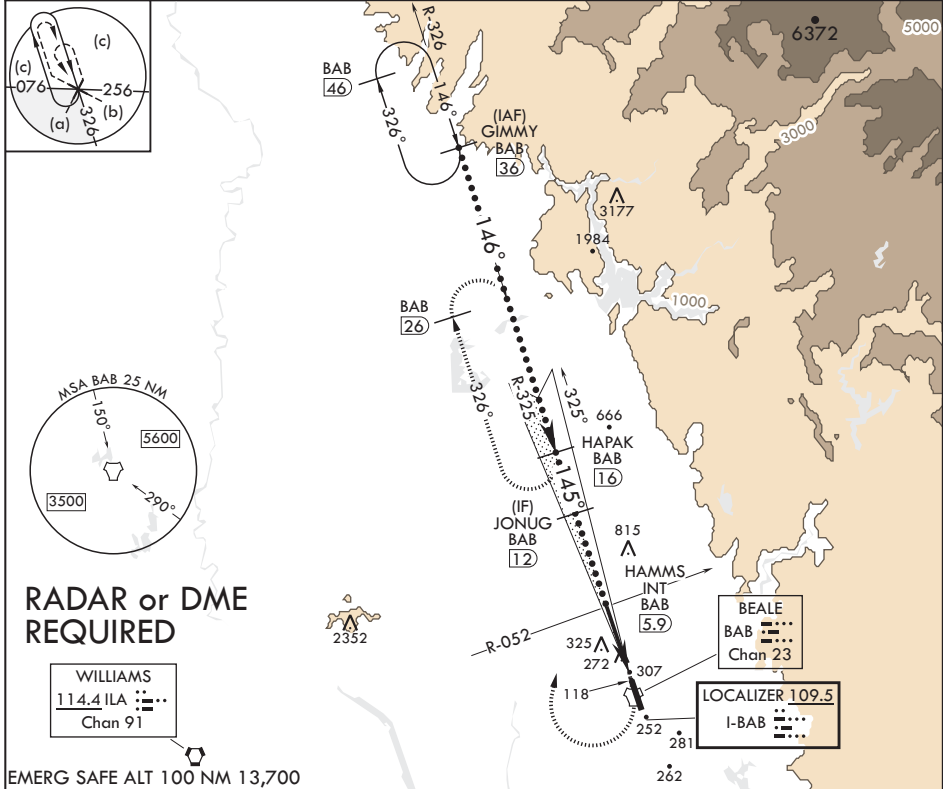

SW-2, 10 SEP 2020 to 08 OCT 2020

SW-2, 10 SEP 2020 to 08 OCT 2020

EMERG SAFE ALT 100 NM 13,700

GIMMY 36	HAPAK 16	JONUG 12	HAMMS INT 5.9	ILR R-052	HEGOP 1.5	TACAN	ELEV 113	TDZE 113
VGSIs and glideslope not coincidental.								
12,000 3600 2600 1600						4400 BAB †LOC only	BAB R-326	
GS 2.75° TCH 47						†2.6 †4.4 NM †0.5	145° 4.9NM from FAF 12,001 x 300	
CATEGORY	C	D	E					
S-ILS 15*	313/24	200	(200-1/2)					
S-LOC 15**	620/55	507	(600-1)					
CIRCLING***	620-1 1/2 507 (600-1 1/2)	680-2 567 (600-2)	840-2 1/2 727 (800-2 1/2)		HIRL all Rwys			

MARYSVILLE, CALIFORNIA

39°08'N - 121°26'W

BEALE AFB (KBAB)

Amdt 5 20JUL17

HI-ILS or LOC Z RWY 15