


| | | | | |
|----------------|-------------|-------------|-------------|-----------|
| LOC/DME I-SJC | APP CRS | Rwy Idg | 30L | 30R |
| 110.9 | 306° | 7614 | 7597 | |
| Chan 46 | | TDZE | 57 | 55 |
| | | Apt Elev | 62 | 62 |

ILS or LOC RWY 30L


NORMAN Y MINETA SAN JOSE INTL (SJC)

| | | | |
|---|--|--------------|--|
| RNAV 1-GPS or RADAR required for procedure entry. DME required. From BORED: RNAV 1-GPS required. | | MALS Rwy 30L | MISSED APPROACH: Climb to 1900 on SJC VOR/DME R-303 to ARTAQ INT/SJC 7 DME and hold. |
| # RVR 1800 authorized with use of FD or AP or HUD to DA. | | | |

| | | | | | | |
|---------------|---------------------|-----------------------------|--------------|--------------|-------|---------------|
| D-ATIS | NORCAL APP CON | SAN JOSE TOWER * | GND CON | CLNC DEL | CPDLC | UNICOM |
| 126.95 | 120.1 290.25 | 124.0 (CTAF) 0 257.6 | 121.7 | 118.0 | | 122.95 |

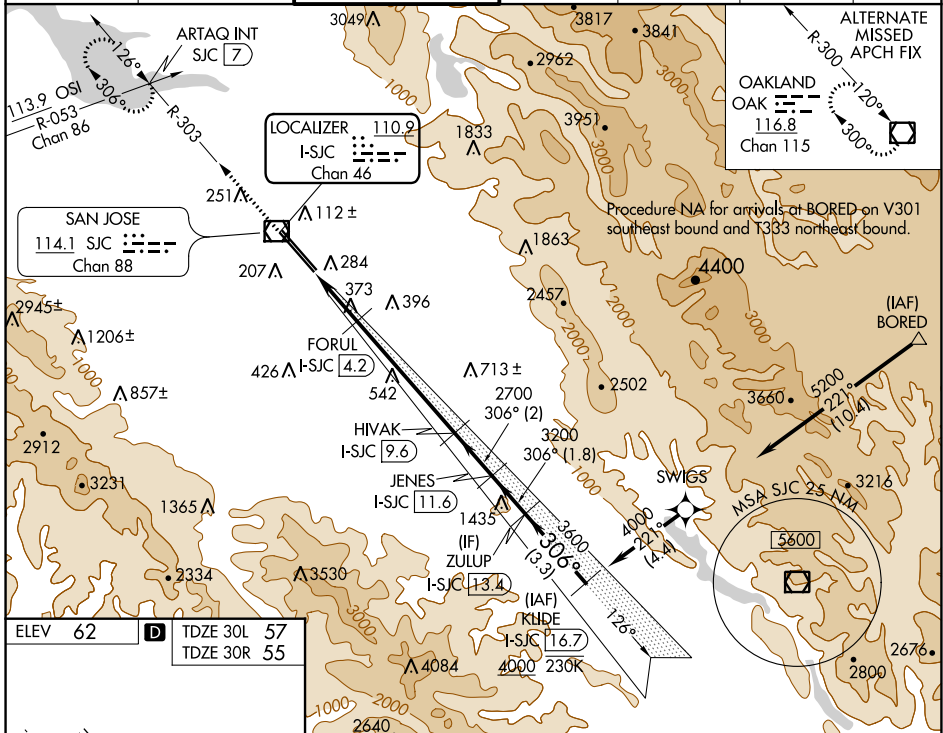

| | | |
|---------|-------------|-------------|
| ELEV 62 | TDZE 30L 57 | TDZE 30R 55 |
|---------|-------------|-------------|

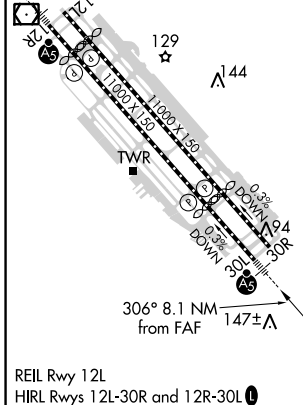

| | | | | |
|-----------|-----------------|---|------------------|------------------|
| 1900 | ARTAQ INT | VGSi and ILS glidepath not coincident (VGSi Angle 3.00/TCH 70). | | KLIDE I-SJC 16.7 |
| SJC R-303 | FORUL I-SJC 4.2 | HIAK I-SJC 9.6 | ZULUP I-SJC 13.4 | 4000 |
| *LOC only | *I-SJC 3 | JENES I-SJC 11.6 | I-SJC 16.7 | |
| I-SJC 1.4 | | 2700 | 3200 | 3600 |
| | | 1000* | 2700 | |
| | | 1.6 NM | 1.2 NM | 5.3 NM |
| | | 2 NM | 1.8 NM | 3.3 NM |
| | | | GS 3.00° | TCH 54 |

| | | | | |
|--------------|----------------------|---------------|-------------|-----------------|
| CATEGORY | A | B | C | D |
| S-ILS 30L# | 257/24 200 (200-1/2) | | | |
| S-LOC 30L | 640/24 | 583 (600-1/2) | 640-1 1/4 | 583 (600-1 1/4) |
| SIDESTEP 30R | 640-1 | 585 (600-1) | 640-1 3/4 | 585 (600-1 3/4) |
| | | | 585 (600-2) | 585 (600-2) |

SW-2, 25 MAR 2021 to 22 APR 2021

SW-2, 25 MAR 2021 to 22 APR 2021