

25051


ILS or LOC RWY 26L
HARTSFIELD/JACKSON ATLANTA INTL (ATL)

T Inop table does not apply to sidestep Rwy 26R Cats A and B. For inop ALS, increase S-LS 26L all Cats visibility to RVR 4500 and S-LOC 26L Cat E visibility to RVR 6000. For inop ALS to Rwy 26R, increase sidestep 26R Cat E visibility to 2 SM. Simultaneous approach authorized.


Rwy 26F
MALSR

MISSED APPROACH: Climb to 1500 then climbing right turn to 4000 on heading 290° and RMG R-132 to DALAS INT/RMG VORTAC 18.5 DME and hold.

D-ATIS	ATLANTA APP CON	ATLANTA TOWER							ALL RWYS	GND CON			ALL RWYS
ARR	119.65	8L-26R	8R-26L	9L-27R	9R-27L	10-28			(8L-26R,8R-26L)	(9L-27R,9R-27L)	10-28		
DEP	125.55	127.9	379.9	119.1	125.325	123.85	119.3	119.5	254.4	121.9	121.75	121.65	254.4



ELEV 1026	D	TDZE 26L 996 TDZE 26R 990
-----------	----------	------------------------------

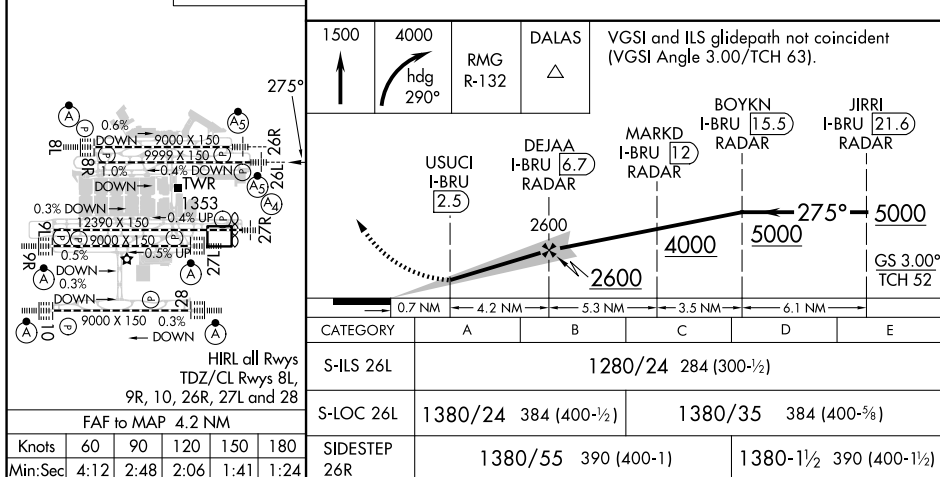

HARTSFIELD/JACKSON ATLANTA INTL (ATL)
33°38'N-84°26'W ILS or LOC RWY 26L