


APP CRS	Rwy Idg	8000
101°	TDZE	815
	Apt Elev	815



RNAV (RNP) Z RWY 10L
JOHN GLENN COLUMBUS INTL (CMH)

RNP AR APCH - GPS.	MALSR	MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct APE VORTAC and hold.
Simultaneous approach authorized. For uncompensated Baro-VNAV systems, procedure NA below -14°C or above 54°C. For inop ALS, increase RNP 0.30 all Cats visibility to RVR 6000.		

D-ATIS	COLUMBUS APP CON	COLUMBUS TOWER	GND CON	CLNC DEL	CPDLC
124.6	125.95 371.975	132.7 257.8	121.9 348.6	126.3	

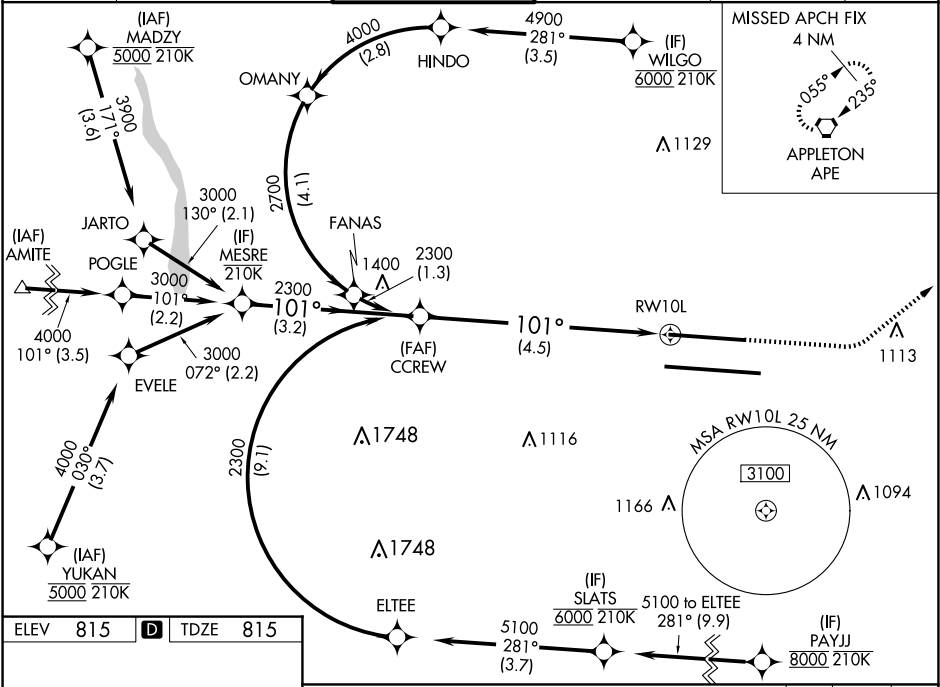

ELEV	815	TDZE	815
------	-----	------	-----

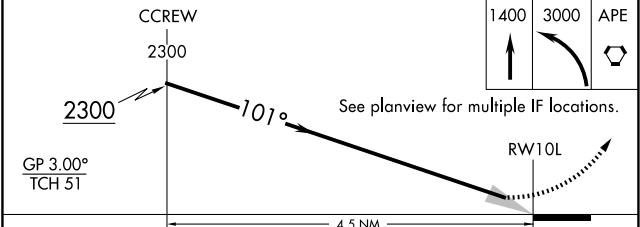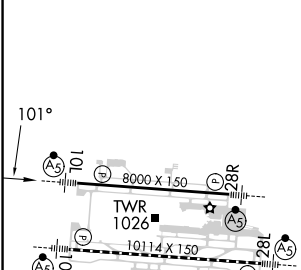

CATEGORY	A	B	C	D
RNP 0.13 DA		1148/26	333 (400-1/2)	
RNP 0.26 DA		1198/35	383 (400-3/8)	
RNP 0.30 DA		1216/40	401 (500-3/4)	

TDZ/CL Rwy 10R and 28L
HIRL Rwy 10R-28L and 10L-28R

AUTHORIZATION REQUIRED