


LOC/DME I-QQV 111.15 Chan 48(Y)	APP CRS 050°	Rwy ldg 10000 TDZE 791 Apt Elev 796	ILS RWY 5R (CAT II & III) INDIANAPOLIS INTL (IND)	
---	------------------------	--	--	--

DME or RADAR required.
Simultaneous approach authorized.

ALSIF-2

MISSED APPROACH: Climb to 1500 then climbing right turn to 3000 on heading 148° and on VHP VORTAC R-136 to OZMOE INT/VHP 20.1 DME and hold.

D-ATIS 134.25	INDIANAPOLIS APP CON 128.175 317.8	INDY TOWER 120.9 251.1	GND CON 121.9	CLNC DEL 128.75 251.1	CPDLC
-------------------------	--	----------------------------------	-------------------------	---------------------------------	-------

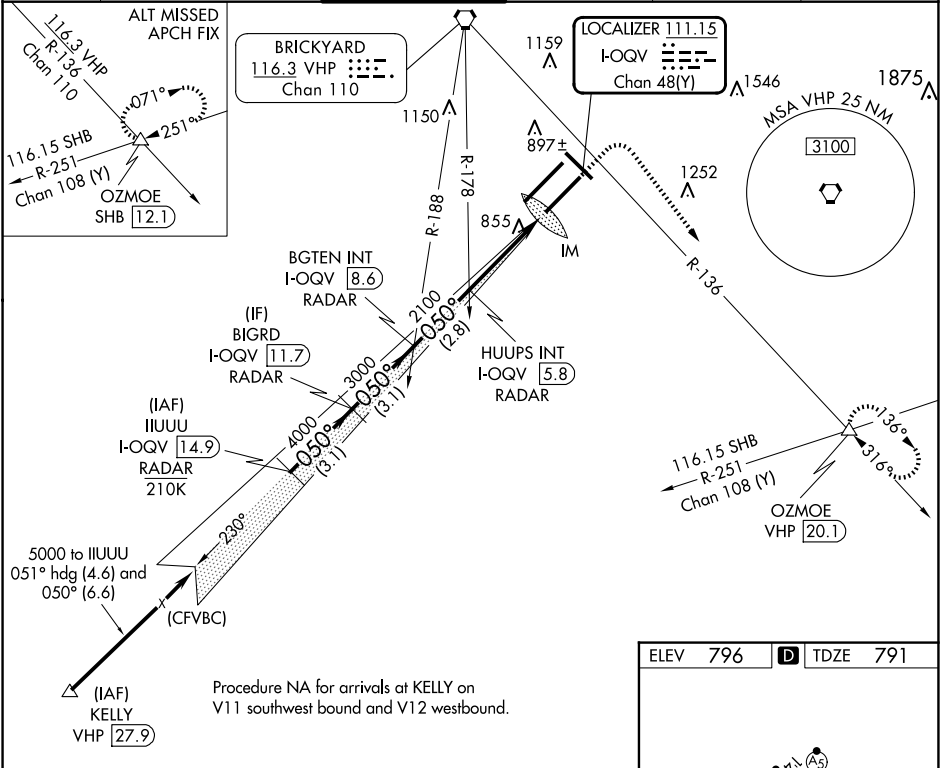

IIUUU VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 71).

I-QQV 14.9 BIGRD I-QQV 11.7 BGTEN INT I-QQV 8.6 HUUPS INT I-QQV 5.8

5000 4000 3000 2100

GS 3.00° TCH 50

3.1 NM 3.1 NM 2.8 NM 4 NM 1031'

IM 909

1500 3000

hdg 148°

VHP R-136

OZMOE

CATEGORY	A	B	C	D
S-ILS 5R	CAT II RA 109/12 100 DA 891			
S-ILS 5R	CAT III RVR 06			

CATEGORY II & III ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

HIRL all Rwys
TDZ/CL Rwys 5L and 5R

INDIANAPOLIS INTL (IND)

ILS RWY 5R (CAT II & III)