


**ILS RWY 9 (CAT II & III)**  
NEW YORK STEWART INTL (SWF)

**MISSED APPROACH:** Climb to 1200 then climbing left turn to 3000 direct IGN VOR/DME and hold.


Procedure NA for arrivals at SAX  
VORTAC on airway radials 029 CW 060.

ELEV 491	<b>D</b>	TDZE 482
----------	----------	----------

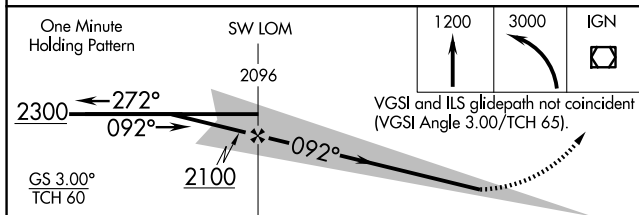

				4.8 NM	1249'	
CATEGORY	A	B	C	D		
S-ILS 9		CAT II RA 97/12	100 DA 582			
S-ILS 9		CAT IIIa RVR 07				
S-ILS 9		CAT IIIb RVR 06				
S-ILS 9		CAT IIIc NA				

## CATEGORY II & III ILS SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

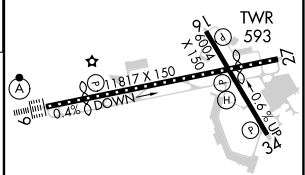

TDZ/CL Rwy 9  
HIRL Rwy 9-27 and 16-34  
REIL Rwy 16, 27 and 34