

YIGO, GUAM I, GUAM

ILS Z or LOC/DME Z RWY 24L

| | | |
|---------------------------|-------------------------|---|
| LOC I-PMY 110.1 | APCH CRS 244° | Rwy Idg TDZE Arpt Elev 11,200 607 617 |
|---------------------------|-------------------------|---|

AL-2147 [USAF]

ANDERSEN AFB (PGUA)

▼ * When ALS inop, increase RVR to 45, vis to ½ mile.
** When ALS inop, increase CAT AB RVR to 55, vis to 1 mile;
CAT CDE RVR to 50, vis to 1 mile.
*** Circling not authorized NW of Rwy 06L-24R.

SALS
(A2)


MISSED APPROACH: Climb to 1200, then climbing left turn to 3000 to intercept UAM R-064 direct PANNS and hold.

| | | | | |
|--------------------------------|------------------------------------|-----------------------------|-------------------------------|----------------------------------|
| ATIS 118.175 254.325 | GUAM APP CON 119.8 269.0 | TOWER 126.2 233.7 | GND CON 121.7 275.8 | CLNC DEL 126.725 256.7 |
|--------------------------------|------------------------------------|-----------------------------|-------------------------------|----------------------------------|



CAUTION: GS unusable below 900' MSL/300' AGL due to runway supervisory unit.

CAUTION: Environmentally Sensitive Area
Flights along Andersen cliffline restricted to 1000' AGL or above.

All touchdown zones have a 1.0% down slope.

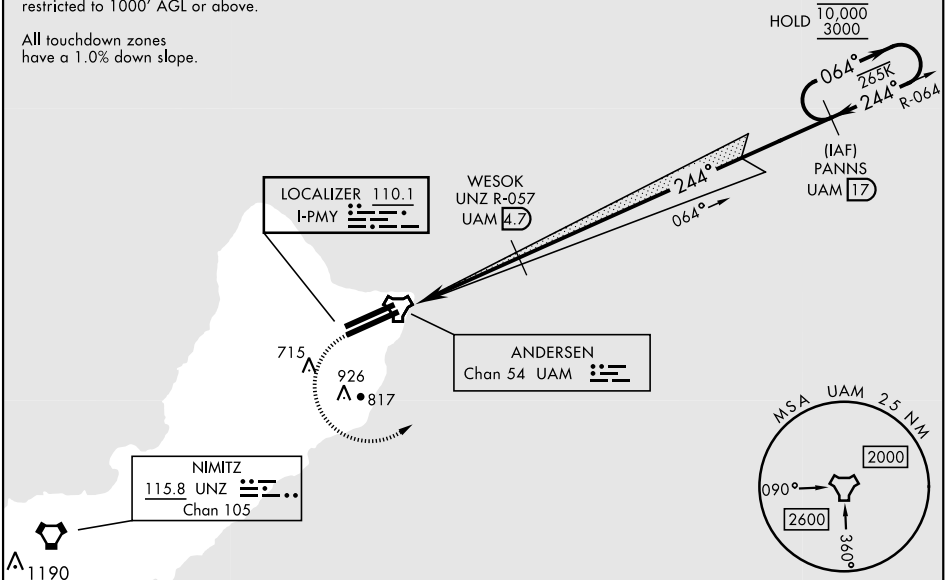

EMERG SAFE ALT 100 NM 2900

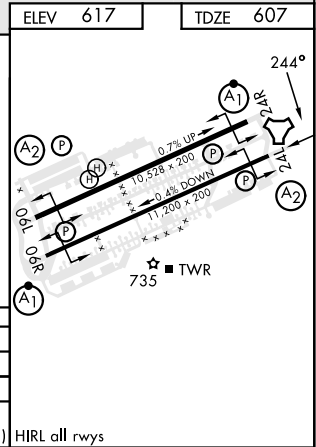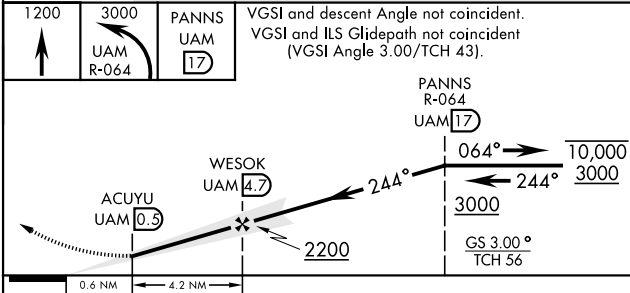

| | | | | | |
|-------------|-----------------------|-----------------------|-------------------------|-----------------------|-------------------------|
| CATEGORY | A | B | C | D | E |
| S-ILS 24L* | 900/40 | 293 | (300-¾) | | |
| S-LOC 24L** | 940/40 | 333 (400-¾) | 940/45 | 333 (400-¾) | |
| CIRCLING*** | 1060-1 443 (500-1) | 1080-1 463 (500-1) | 1240-1¾ 623 (700-1¾) | 1240-2 623 (700-2) | 1240-2¼ 623 (700-2¼) |

HIRL all rwy's

YIGO, GUAM I, GUAM

13° 35' N-144° 56' E

ANDERSEN AFB (PGUA)

Orig 12AUG21
TERPS

ILS Z or LOC/DME Z RWY 24L

PAC, 12 JUN 2025 to 07 AUG 2025

PAC, 12 JUN 2025 to 07 AUG 2025