


WAAS CH 61038 W05A	APP CRS 053°	Rwy Idg TDZE 270 Apt Elev 273	5005
--	------------------------	---	-------------


RNAV (GPS) RWY 5

SANDERSON FLD (SHN)

RNP APCH - GPS.		MISSED APPROACH: Climb to 3000 direct CARRO and hold.
<div><div><div><div><div></div><div></div></div><div><div></div><div></div></div></div><div><div><div></div></div><div><div></div></div></div></div></div> <div>Circling NA for Cats C and D south of Rwy 5-23. Rwy 5 helicopter visibility reduction below ¾ SM NA. When local altimeter setting not received, use OLM altimeter setting; increase all MDAs 60 feet and increase LNAV visibility Cats C and D ¼ SM; increase Circling visibility Cat C ¼ SM.</div>		
ASOS 119.275	SEATTLE APP CON 121.1 290.9	UNICOM 122.8 (CTAF) 0

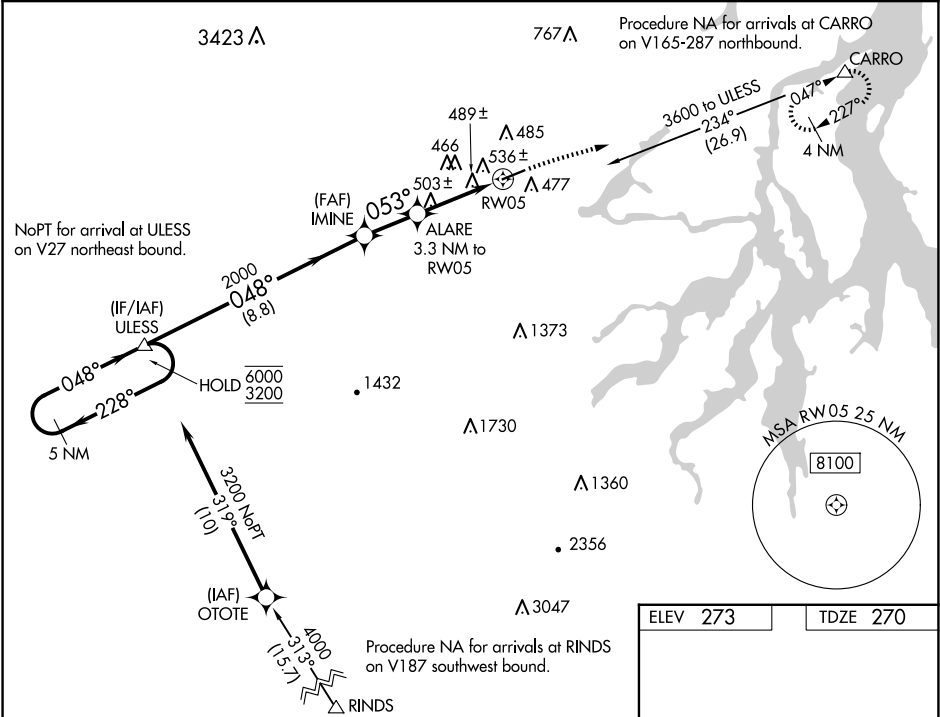

Visual Segment - Obstacles.					3000	CARRO
5 NM Holding Pattern					↑	Δ
6000 3200 228° 048° 048° 2000 053° 1340					RW05	
8.8 NM 2 NM 3.3 NM						
CATEGORY	A	B	C	D		
IP MDA	740-1	470 (500-1)	740-1⅓	470 (500-1⅓)		
LNAV MDA	800-1	530 (600-1)	800-1½	530 (600-1½)		
CIRCLING	840-1 567 (600-1)	860-1 587 (600-1)	860-1½ 587 (600-1½)	1200-3 927 (1000-3)		

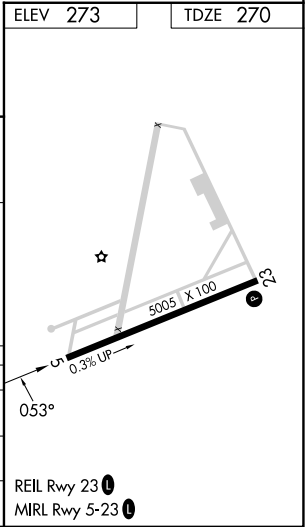

NW-1, 10 JUL 2025 to 07 AUG 2025

NW-1, 10 JUL 2025 to 07 AUG 2025