


APP CRS	Rwy Idg	5022
020°	TDZE	3090
	Apt Elev	3090

RNAV (GPS) RWY 2

MAJOR SAMUEL B CORNELIUS FLD (E42)

<div><div>▼</div><div>DME/DME RNP-0.3 NA. Visibility reduction by helicopters NA. Use Borger altimeter setting; when not received, use Rick Husband Amarillo Intl altimeter setting and increase all MDA 140 feet, increase LNAV Cat B visibility ¼ mile, LNAV Cat C visibility ½ mile, Circling Cat A visibility ¼ mile, and Circling Cat C visibility ½ mile.</div></div>	<div><div>⚠</div><div>NA</div></div>	<div>MISSED APPROACH: Climbing left turn to 6000 direct OYUSA hold.</div>
---	--------------------------------------	---

AWOS-3P 118.925	ALBUQUERQUE CENTER 127.85 285.475	CTAF 122.9
--------------------	--------------------------------------	---------------

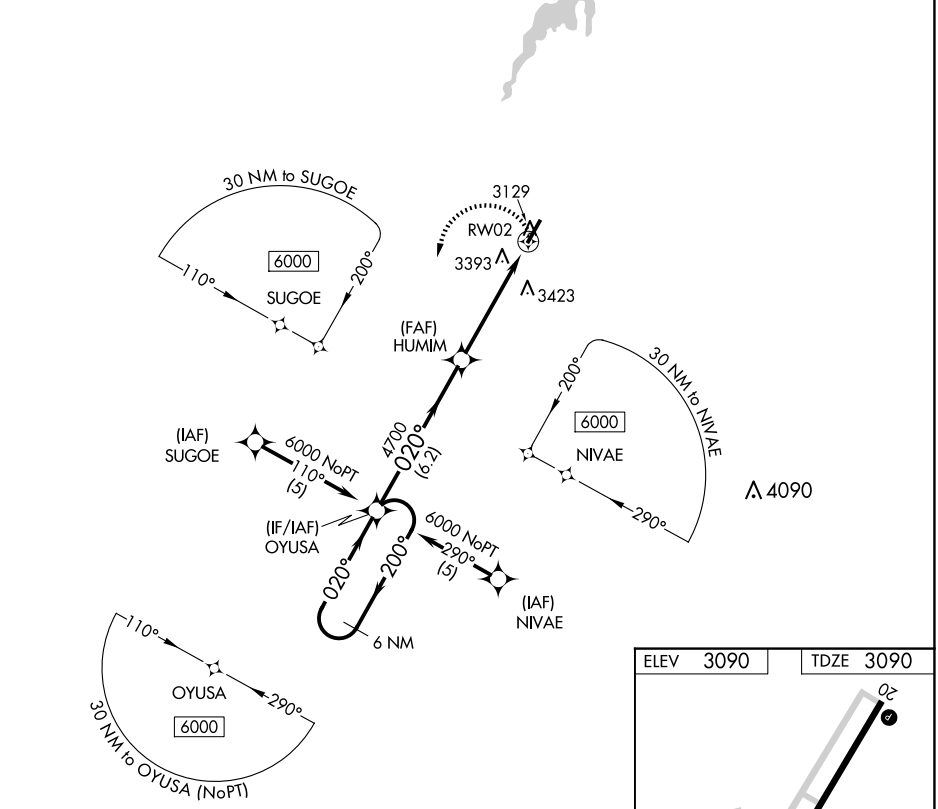

6 NM Holding Pattern		VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 39).		6000	OYUSA
6000		200°		020°	
		020°		020°	
		HUMIM		3.04°	TCH 40
		4700		RWY 2	
		6.2 NM		4.9 NM	
CATEGORY	A	B	C	D	
LNAV MDA	3780-1	690 (700-1)	3780-2	NA	
			690 (700-2)		
CIRCLING	3840-1	3840-1¼	3840-2¼	NA	
	750 (800-1)	750 (800-1¼)	750 (800-2¼)		

