


APP CRS	Rwy Ldg	5700
005°	TDZE	6757
	Apt Elev	6763


RNAV (GPS) RWY 36
PANGUITCH MUNI (U55)

<p>T DME/DME RNP-0.3 NA. When local altimeter setting not received use Bryce Canyon altimeter setting and increase all MDA 160 feet.</p> <p>A -28°C VDP NA with Bryce Canyon altimeter setting.</p>	<p>MISSED APPROACH: Climb to 12000 direct IFCU and on track 326° to DETAN and hold.</p>
---	---

AWOS-3 133.125	SALT LAKE CENTER 133.6 269.25	CTAF 122.9 1
-------------------	----------------------------------	------------------------

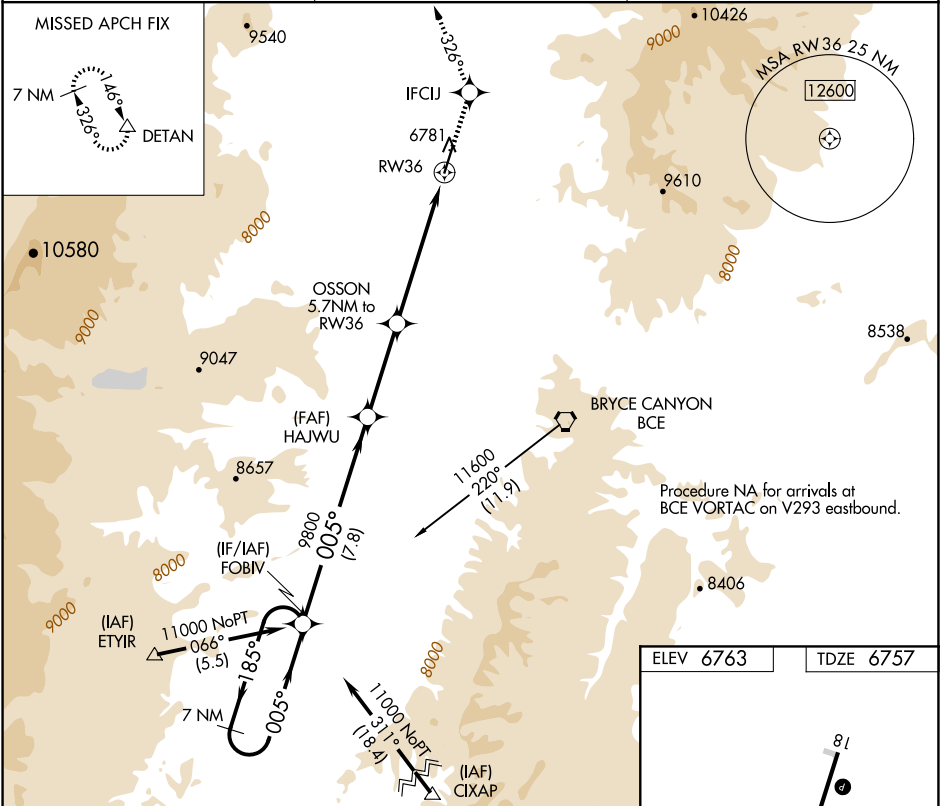

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 40).			
7 NM Holding Pattern	FOBIV	HAJWU	IFCU
11000	185°	005°	326°
9800	005°	8640	326°
7.8 NM	3.5 NM	2.2 NM	3.5 NM
OSSON 5.7 NM to RW36	3.06° TCH 40	3.5 NM to RW36	
7900-1¼	7900-1½	NA	NA
1143 (1200-1¼)	1143 (1200-1½)		
7900-1¼	7900-1½	NA	NA
1137 (1200-1¼)	1137 (1200-1½)		

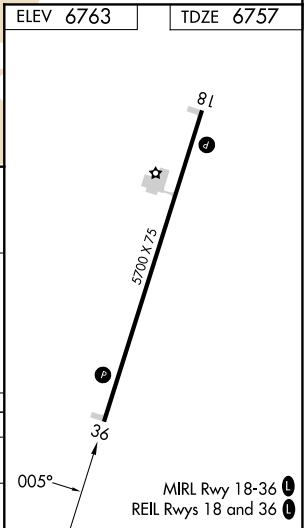

SW-4, 10 JUL 2025 to 07 AUG 2025

SW-4, 10 JUL 2025 to 07 AUG 2025