



APP CRS	Rwy Idg	8000
281°	TDZE	813
	Apt Elev	815





RNAV (RNP) Z RWY 28R
JOHN GLENN COLUMBUS INTL (CMH)

RNP AR APCH.			<div>MALSR</div> <div><div><div><div></div></div><div><div></div></div></div><div><div></div></div></div>		MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 to APE VORTAC and hold.	
▼ For uncompensated Baro-VNAV systems, procedure NA below -19°C or above 54°C. For inop ALS, increase RNP 0.16 all Cats visibility to RVR 4500 and increase RNP 0.30 all Cats visibility to RVR 5500. Simultaneous approach authorized.						
D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC	

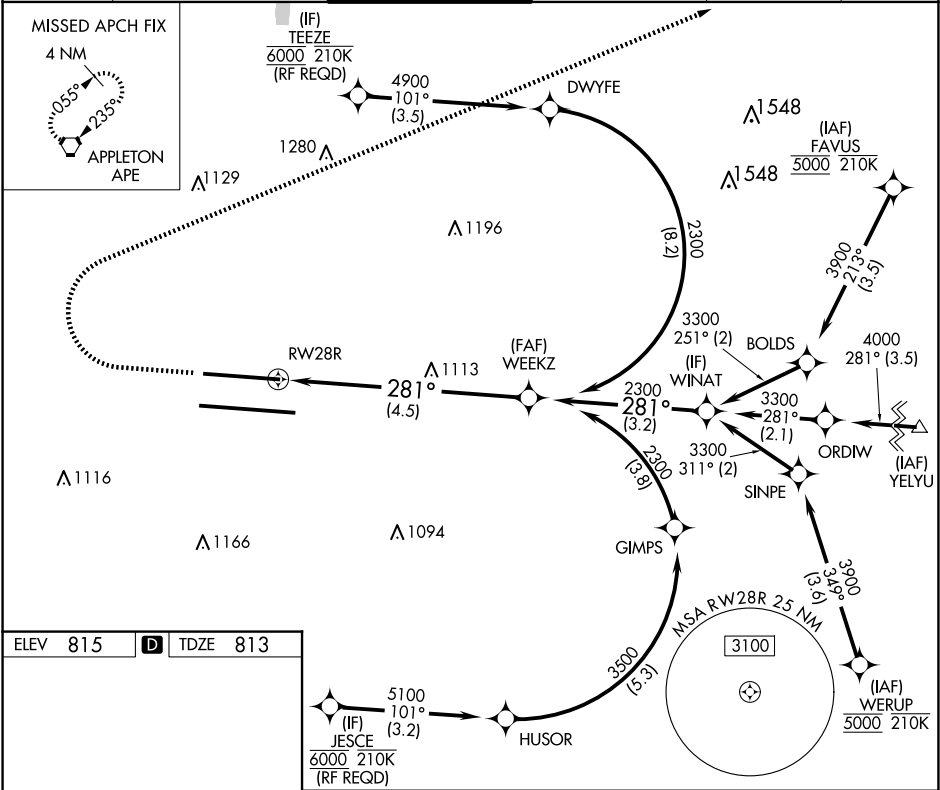

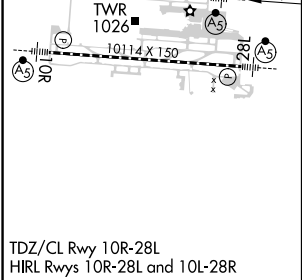ELEV 815	TDZE 813
----------	----------

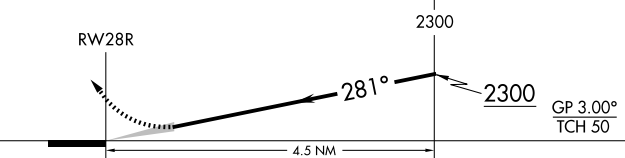

See planview for multiple IF locations.				
1400	3000	APE		
				
				
CATEGORY	A	B	C	D
RNP 0.16 DA	1129/24	316 (400-½)		
RNP 0.30 DA	1185/35	372 (400-⅝)		
AUTHORIZATION REQUIRED				