

APP CRS  
227°

Rwy Idg  
TDZE  
Apt Elev

8000  
938  
956

RNAV (GPS) RWY 23

DONALDSON FLD (GYH)

RNP APCH - GPS.


▼

⚠

Rwy 23 helicopter visibility reduction below ¾ SM NA. When local altimeter setting not received, use Greer altimeter setting and increase all MDAs 40 feet and LNAV visibility Cat C/D ½ SM. VDP NA when using Greer altimeter setting.

MISSED APPROACH:  
Climb to 3000 direct NINYI and hold.

AWOS-3 127.325	GREER APP CON ★ 118.8 270.275	DONALDSON TOWER ★ 133.325 (CTAF) 0 269.25	GND CON 121.4	CLNC DEL 121.4	UNICOM 122.7
-------------------	----------------------------------	--	------------------	-------------------	-----------------

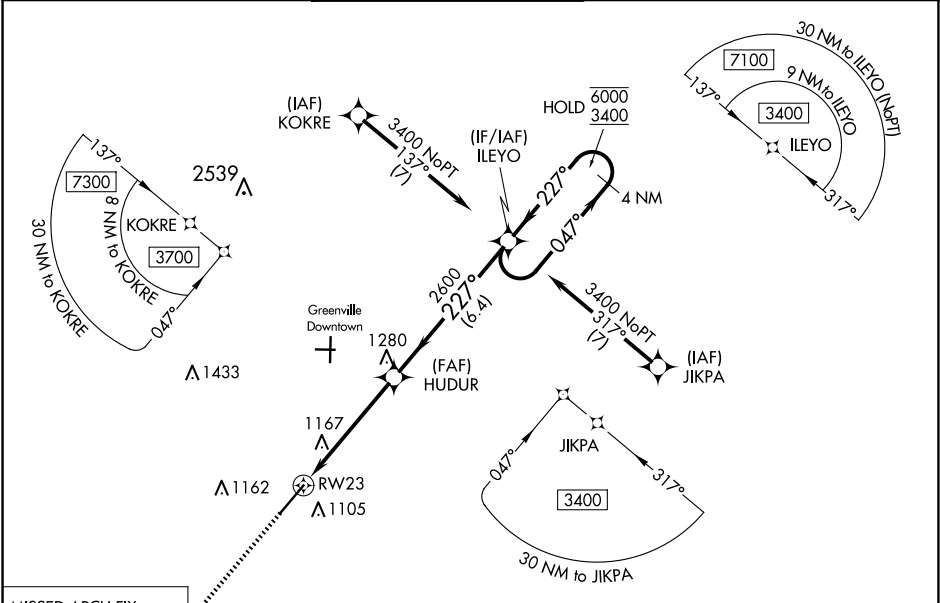

MISSED APCH FIX

4 NM 227° 047° NINYI

ELEV 956

TDZE 938

3000

NINYI

VGSI and descent angles not coincident (VGSI Angle 4.14/TCH 95).

ILEYO 4 NM holding pattern

HUDUR 2600 047° 6000 3400

0.9 NM to RWY 23

0.9 NM 4.1 NM 6.4 NM

CATEGORY	A	B	C	D
LNAV MDA	1420-1	482 (500-1)	1420-1⅓	482 (500-1⅓)
CIRCLING	1420-1 464 (500-1)	1480-1 524 (600-1)	1480-1½ 524 (600-1½)	1520-2 564 (600-2)

HIRL Rwy 5-23