



LOC/DME I-SJW 111.3 Chan 50	APP CRS 303°	Rwy Ldg TDZE Apt Elev 9013 605 618	ILS RWY 30R (CAT II & III) ST LOUIS LAMBERT INTL (STL)	
---	------------------------	--	---	--

RADAR required for procedure entry.		ALSF-2	MISSED APPROACH: Climb to 1020 then climbing right turn to 3000 direct TOY VORTAC and hold.
Simultaneous approach authorized with Rwy 29.			

D-ATIS 125.025 379.925	ST. LOUIS APP CON 132.125 360.6	ST. LOUIS TOWER 120.05 284.6	GND CON 121.9 348.6 (Inbound) 121.65 377.175 (Outbound) 118.925 227.125 (Rwy 11/29)	CLNC DEL 119.5 363.1	CPDLC
--	---	--	---	--------------------------------	-------

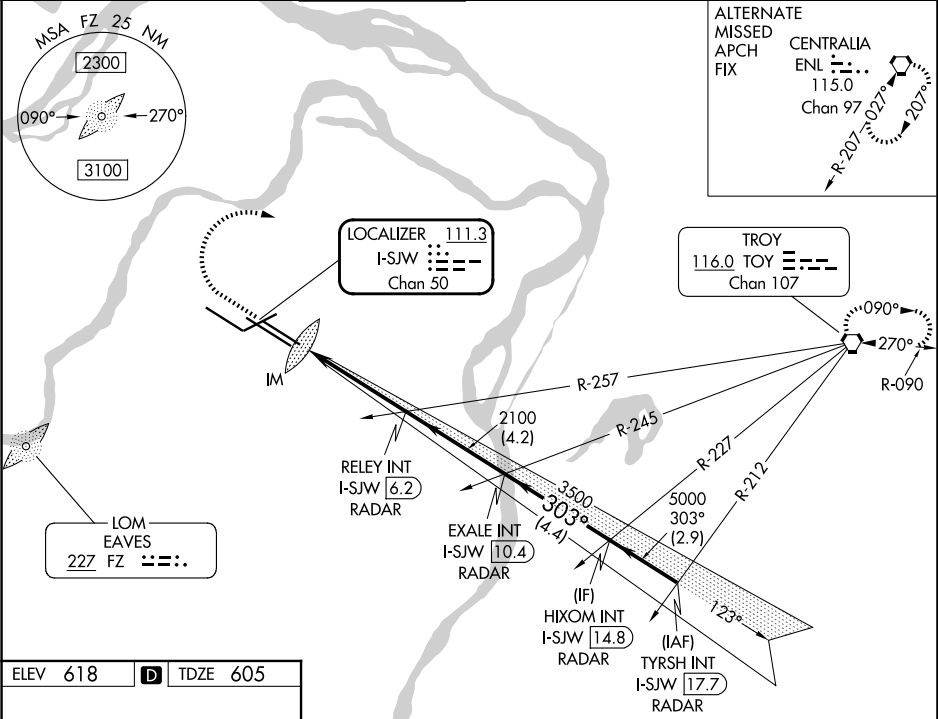

ELEV 618	D	TDZE 605
----------	----------	----------

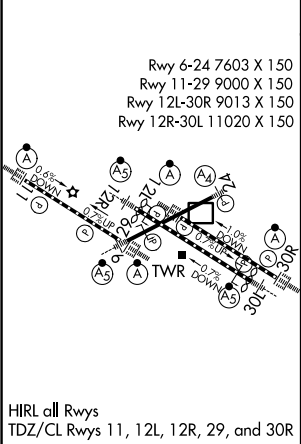

1020	3000	TOY	RELEY INT I-SJW 6.2 RADAR	EXALE INT I-SJW 10.4 RADAR	HIXOM INT I-SJW 14.8 RADAR	TYRSH INT I-SJW 17.7 RADAR
IM	2100	3500	5000	5000	5000	5000
705	2100	3500	5000	5000	5000	5000
1.200°	4.5 NM	4.2 NM	4.4 NM	2.9 NM		
CATEGORY	A	B	C	D		
S-ILS 30R	CAT II RA 116/12 100 DA 705					
S-ILS 30R	CAT III RVR 06					

CATEGORY II & III ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED