

LOC I-TVN	APP CRS	Rwy Ldg	9801
111.9	185°	TDZE	609
		Apt Elev	629

ILS or LOC RWY 18L
HUNTSVILLE INTL-CARL T JONES FLD (HSV)



Simultaneous approach authorized. Circling NA for Cat C/D/E east of Rwy 18L-36R. For inop ALS, increase S-ILS 18L Cat E visibility to RVR 4000 and S-LOC 18L Cat E visibility to 1 3/4 SM; FEKSO Fix minimums increase S-LOC 18L Cat E visibility to RVR 6000.

* RVR 1800 authorized with use of FD or AP or HUD to DA.


MALSR

MISSED APPROACH: Climb to 2500 then climbing left turn to 4000 on heading 160° and VUZ R-011 to FEWER INT/VUZ 39.4 DME and hold.

ATIS	HUNTSVILLE APP CON *	HUNTSVILLE TOWER *	GND CON	CLNC DEL	UNICOM
121.25	125.6 354.1	127.6 (CTAF) 0 350.35	121.9 269.525	120.35	122.95

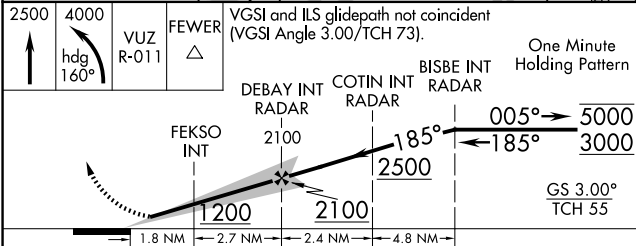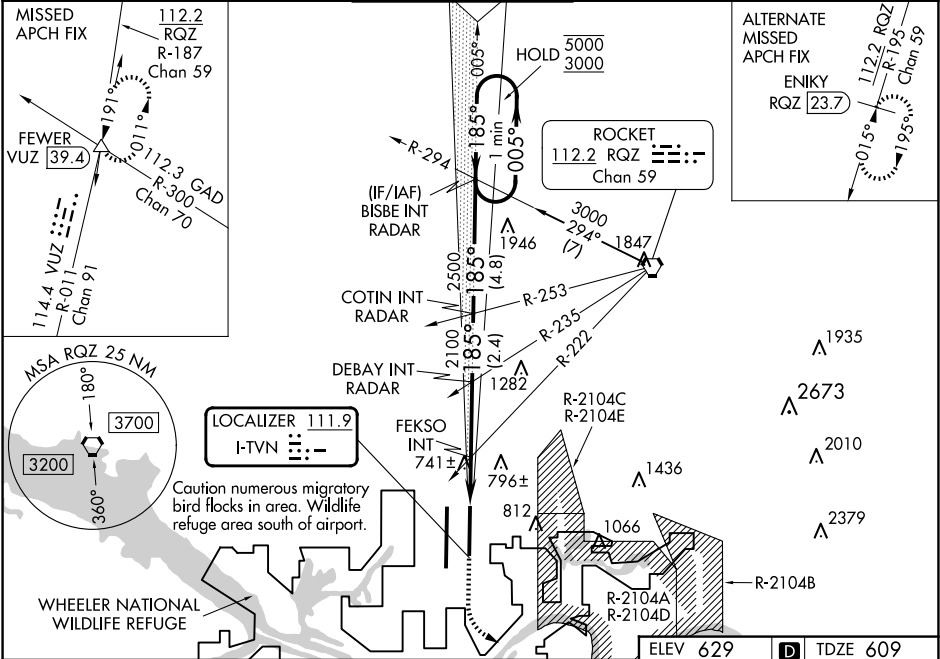

CATEGORY	A	B	C	D	E
S-ILS 18L *	809/24 200 (200-1/2)				
S-LOC 18L	1200/24	591 (600-1/2)	1200-1 3/4	591 (600-1 1/4)	
CIRCLING	1200-1	571 (600-1)	1200-1 3/4	1240-2	1260-2 1/4
FEKSO FIX MINIMUMS (DUAL VOR RECEIVERS REQUIRED)					
S-LOC 18L	1000/24	391 (400-1/2)	1000/35	391 (400-1/2)	
CIRCLING	1160-1	531 (600-1)	1160-1 1/2	1240-2	1260-2 1/4

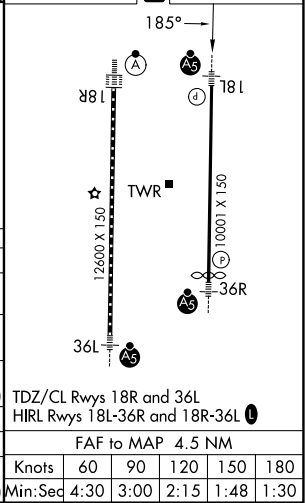

SE-4, 07 AUG 2025 to 04 SEP 2025

SE-4, 07 AUG 2025 to 04 SEP 2025