


APP CRS	Rwy Ldg	5700
005°	TDZE	6757
	Apt Elev	6763


RNAV (GPS) RWY 36
PANGUITCH MUNI (U55)

<p>T A -27°C</p>	<p>DME/DME RNP-0.3 NA. When local altimeter setting not received use Bryce Canyon altimeter setting and increase all MDA 160 feet. VDP NA with Bryce Canyon altimeter setting.</p>	<p>MISSED APPROACH: Climb to 12000 direct IFCIJ and on track 326° to DETAN and hold.</p>
---	--	--

<p>AWOS-3 133.125</p>	<p>SALT LAKE CENTER 133.6 269.25</p>	<p>CTAF 122.9 !</p>
---------------------------	--	--------------------------------

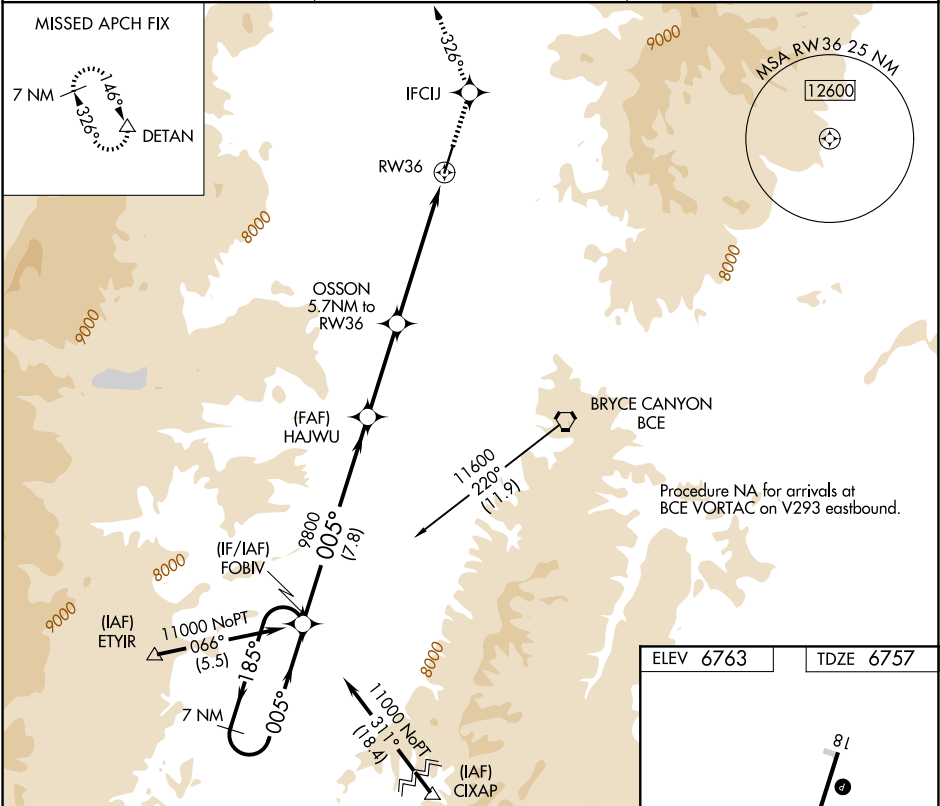

VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 40).			
7 NM Holding Pattern	FOBIV	HAJWU	IFCIJ tr 326°
11000 ← 185°	005°	9800	8640
OSSON 5.7 NM to RW36 3.06° TCH 40 3.5 NM to RW36			
7.8 NM 3.5 NM 2.2 NM 3.5 NM			
CATEGORY	A	B	C D
LNVA MDA	7900-1¼ 1143 (1200-1¼)	7900-1½ 1143 (1200-1½)	NA
CIRCLING	7900-1¼ 1137 (1200-1¼)	7900-1½ 1137 (1200-1½)	NA

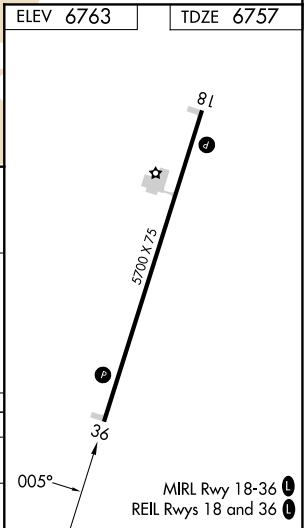

SW-4, 07 AUG 2025 to 04 SEP 2025

SW-4, 07 AUG 2025 to 04 SEP 2025