

TAMPA, FLORIDA

AL-416 (FAA)

25163




LOC/DME I-TPA	APP CRS	Rwy Ldg	8300
110.3	187°	TDZE	26
Chan 40		Apt Elev	26

ILS RWY 19L (SA CAT I)

TAMPA INTL (TPA)

RADAR required for procedure entry.		ALSIF-2 	MISSED APPROACH: Climb to 600 then climbing left turn to 4000 on heading 160° and on PIE VORTAC R-138 to GIBBS INT and hold.
	Simultaneous approach authorized.		
	Requires specific OPSPEC, MSPEC, or LOA approval.		

ARR	D-ATIS	DEP	TAMPA APP CON	TAMPA TOWER	GND CON	CLNC DEL	CPDLC
126.45		128.475	118.5 307.175	119.5 269.4	121.7 269.4	133.6	

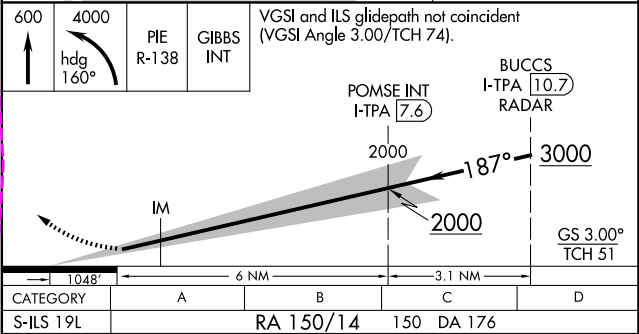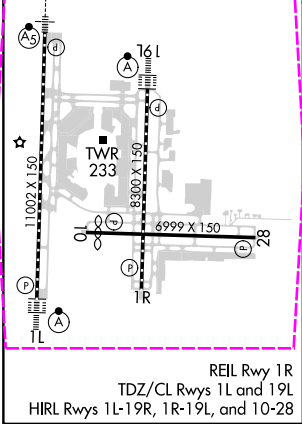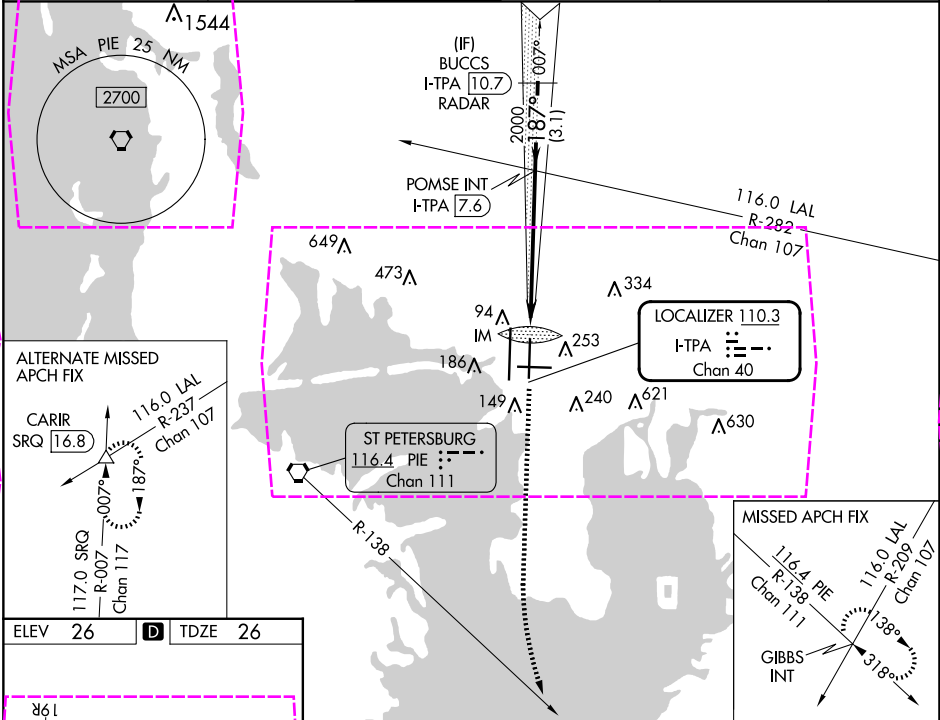

SA CATEGORY I ILS- SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED			
CATEGORY	A	B	C
S-ILS 19L	RA 150/14	150	DA 176

TAMPA, FLORIDA
Amdt 42A 12JUN25

27°59'N-82°32'W

TAMPA INTL (TPA)
ILS RWY 19L (SA CAT I)

TAMPA, FLORIDA

AL-416 (FAA)

25219

LOC/DME I-TPA	APP CRS	Rwy Ldg	8300
110.3	187°	TDZE	26
Chan 40		Apt Elev	26

ILS RWY 19L (SA CAT I)
TAMPA INTL (TPA)

RADAR required for procedure entry.


Simultaneous approach authorized.

Requires specific OPSPEC, MSPEC, or LOA approval.



ALSIF-2

MISSED APPROACH: Climb to 600 then climbing left turn to 4000 on heading 160° and on PIE VORTAC R-138 to GIBBS INT and hold.

ARR	D-ATIS	DEP	TAMPA APP CON	TAMPA TOWER	GND CON	CLNC DEL	CPDLC
126.45	128.475		118.5 307.175	119.5 269.4	121.7 269.4	133.6	

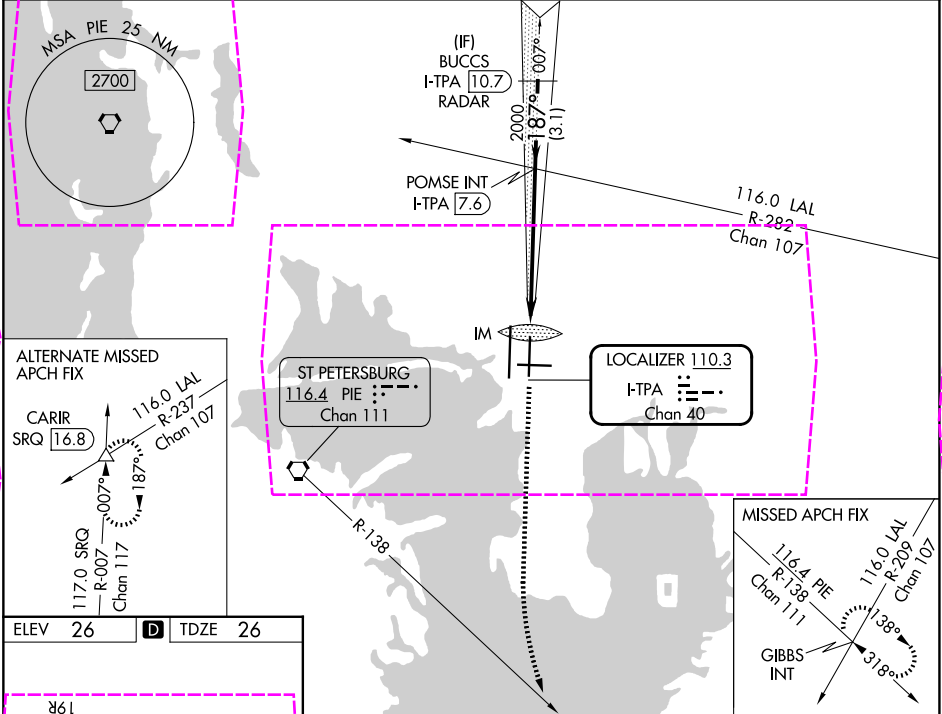

ELEV	26	TDZE	26
------	----	------	----

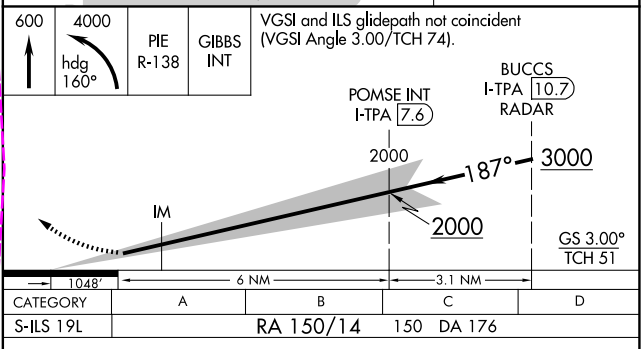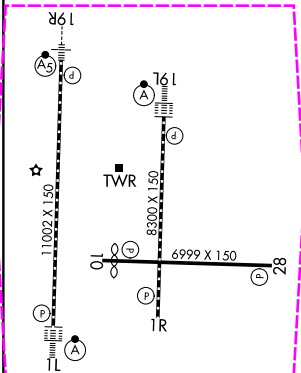

REIL Rwy 1R	TDZ/CL Rwy 1L and 19L	HIRL Rwy 1L-19R, 1R-19L, and 10-28
-------------	-----------------------	------------------------------------

SA CATEGORY I ILS- SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

TAMPA, FLORIDA
Amdt 42A 12JUN25

27°59'N-82°32'W

TAMPA INTL (TPA)
ILS RWY 19L (SA CAT I)