

CLAREMONT, NEW HAMPSHIRE

AL-5617 (FAA)

23278

APP CRS	Rwy Idg	3098
289°	TDZE	543
	Apt Elev	544

RNAV (GPS) RWY 29

CLAREMONT MUNI (CNH)


NA

-25°C


When local altimeter setting not received, use Hartsness State altimeter setting and increase all MDAs 20 feet. DME/DME RNP-0.3 NA. Procedure NA at night. Rwy 11, 29 helicopter visibility reduction below 1 SM NA.




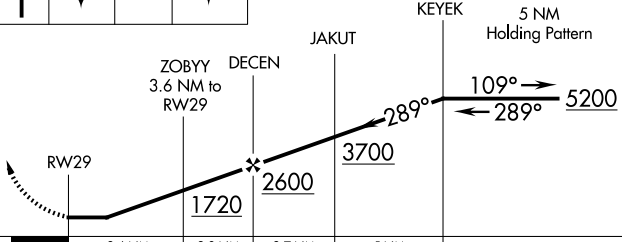
MISSED APPROACH: Climb to 5400 direct UPESY and on track 239° to JAMMA and hold, continue climb-in-hold to 5400.

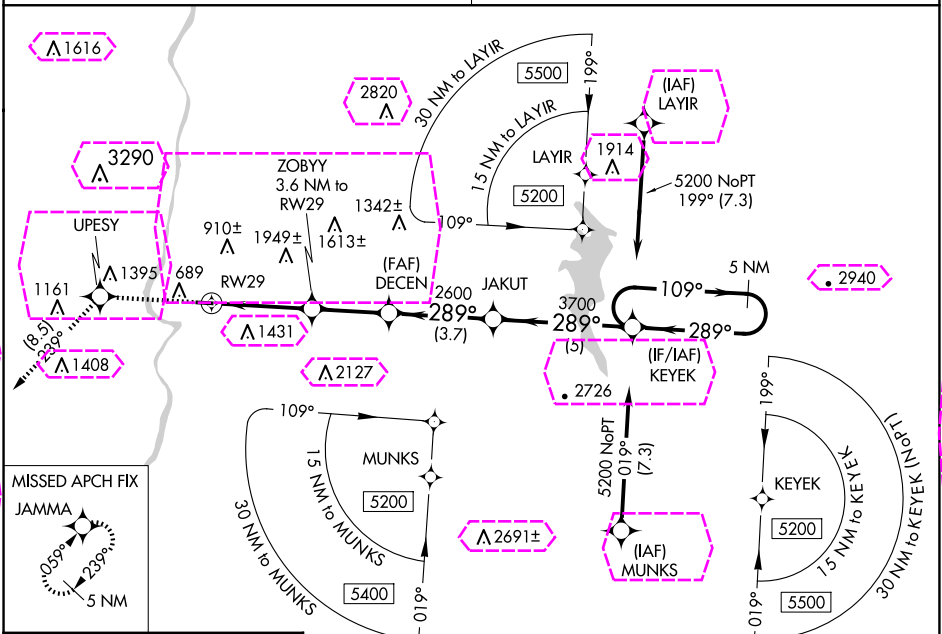BOSTON CENTER 134.7 269.475	UNICOM 122.7 (CTAF) 0
--------------------------------	--------------------------

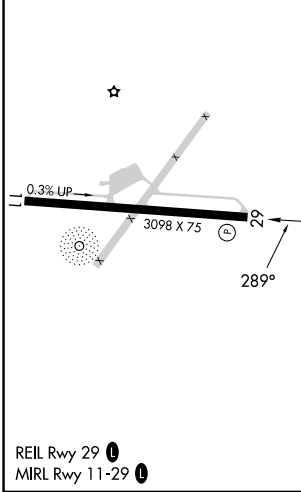

ELEV 544	TDZE 543
----------	----------



5400	UPESY	JAMMA	Visual Segment - Obstacles.		
		tr 239°			
					
CATEGORY	A		B	C	D
LNAV MDA	1520-1¼ 977 (1000-1¼)		1520-1½ 977 (1000-1½)	NA	
CIRCLING	1520-1¼ 976 (1000-1¼)		1740-1½ 1196 (1200-1½)	NA	


APP CRS	Rwy Ldg	3098
289°	TDZE	543
	Apt Elev	544

RNAV (GPS) RWY 29
CLAREMONT MUNI (CNH)


When local altimeter setting not received, use Hartness State altimeter setting and increase all MDAs 20 feet. DME/DME RNP-0.3 NA. Procedure NA at night. Rwy 11, 29 helicopter visibility reduction below 1 SM NA.

MISSED APPROACH: Climb to 5400 direct UPESY and on track 239° to JAMMA and hold, continue climb-in-hold to 5400.

BOSTON CENTER
134.7 269.475

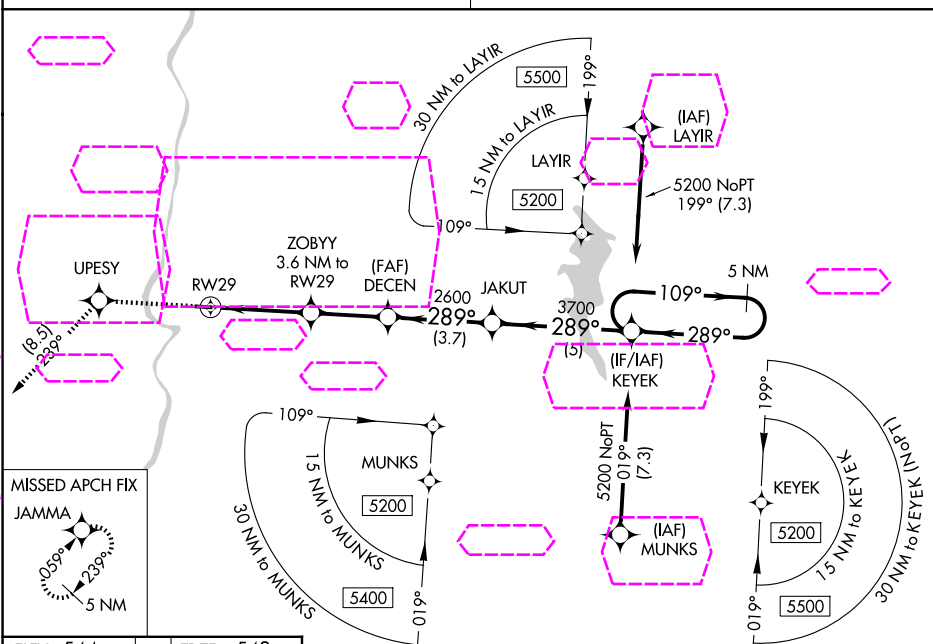UNICOM
122.7 (CTAF) **L**


ELEV 544		TDZE 543
----------	--	----------

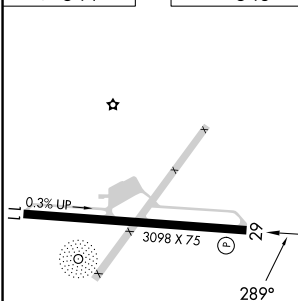

REIL Rwy 29 **L**
MIRL Rwy 11-29 **L**

5400	UPESY	tr 239°	JAMMA
------	-------	------------	-------

Visual Segment - Obstacles.

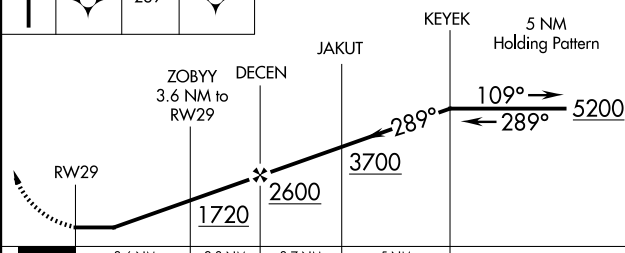

CATEGORY	A	B	C	D
LNAV MDA	1520-1¼ 977 (1000-1¼)	1520-1½ 977 (1000-1½)	NA	
CIRCLING	1520-1¼ 976 (1000-1¼)	1740-1½ 1196 (1200-1½)	NA	

CLAREMONT, NEW HAMPSHIRE
Orig-C 30DEC21

43°22'N - 72°22'W

CLAREMONT MUNI (CNH)
RNAV (GPS) RWY 29