

COLUMBUS, OHIO

AL-94 (FAA)

25163

LOC/DME I-CMH 111.75 Chan 54 (Y)	APP CRS 281°	Rwy Ldg 10114 TDZE 815 Apt Elev 815
--	------------------------	--

ILS RWY 28L (SA CAT I & II)


JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required.

Simultaneous approach authorized.
SA CAT I, SA CAT II: Requires specific OPSPEC, MSPEC, or LOA approval.

MALSR
MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BU LOM and hold.



D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC
------------------------	---	--------------------------------------	-------------------------------	--------------------------	-------

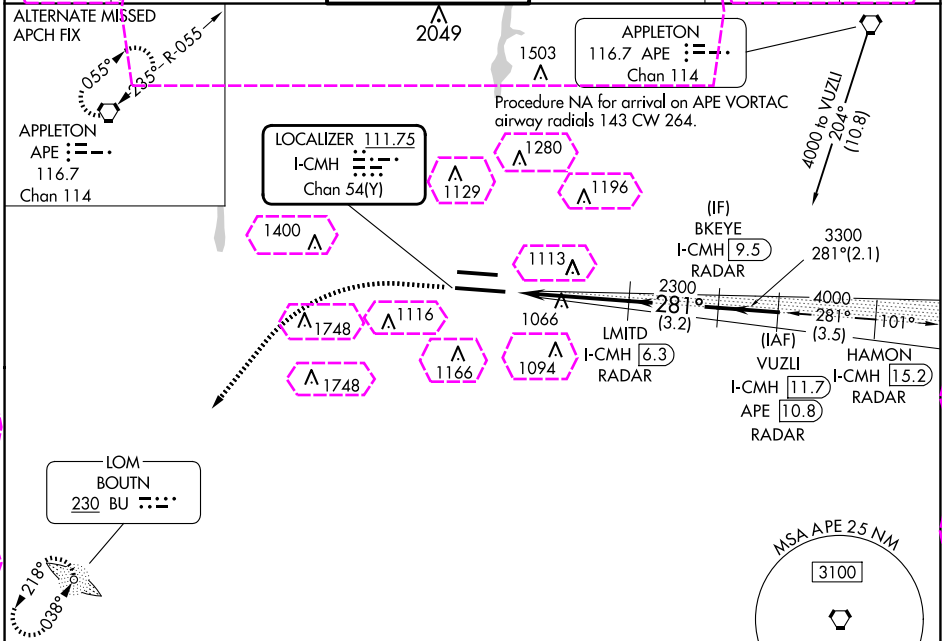

EC-2, 30 OCT 2025 to 27 NOV 2025

EC-2, 30 OCT 2025 to 27 NOV 2025

ELEV 815	D	TDZE 815
----------	----------	----------

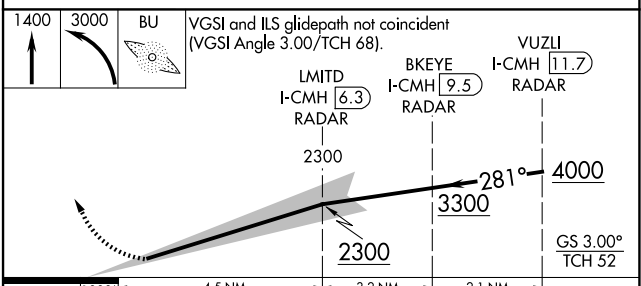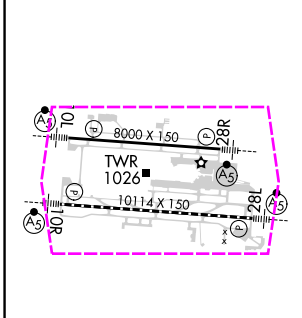

CATEGORY	A	B	C	D
S-ILS 28L	SA CAT I RA 157/14 150 DA 965			
S-ILS 28L	SA CAT II RA 100/12 100 DA 915			

SA CATEGORY I & II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

COLUMBUS, OHIO
Amdt 31 22APR21

JOHN GLENN COLUMBUS INTL (CMH)
40°00'N-82°54'W
ILS RWY 28L (SA CAT I & II)

COLUMBUS, OHIO

AL-94 (FAA)

25331

LOC/DME I-CMH 111.75	APP CRS 281°	Rwy Ldg 10114 TDZE 815 Apt Elev 815
Chan 54 (Y)		

ILS RWY 28L (SA CAT I & II)

JOHN GLENN COLUMBUS INTL (CMH)


ADF required. DME or RADAR required.

Simultaneous approach authorized.
SA CAT I, SA CAT II: Requires specific OPSPEC, MSPEC, or LOA approval.

MALSR

MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BU LOM and hold.



D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6
------------------------	---	--------------------------------------	-------------------------------

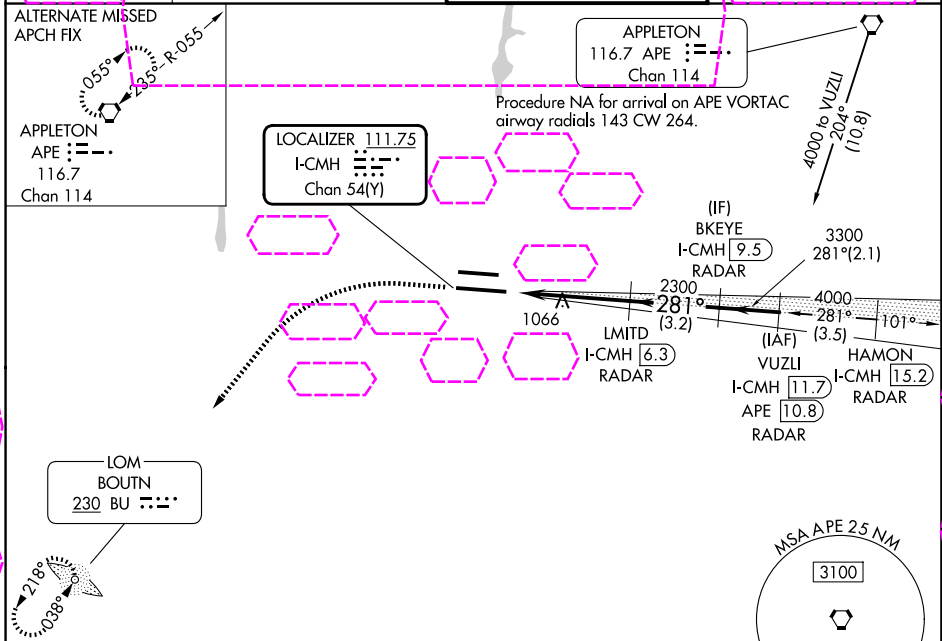

EC-2, 27 NOV 2025 to 25 DEC 2025

EC-2, 27 NOV 2025 to 25 DEC 2025

ELEV 815	D	TDZE 815
-----------------	----------	-----------------

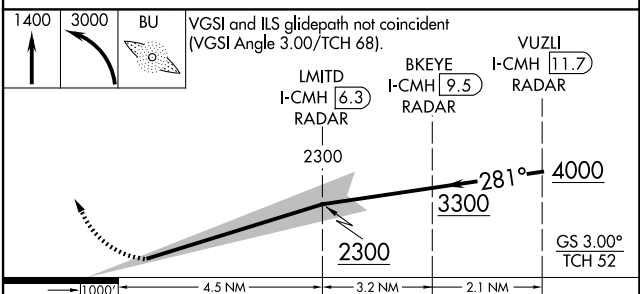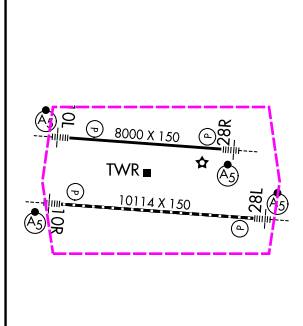

CATEGORY	A	B	C	D
S-ILS 28L		SA CAT I RA 157/14	150 DA 965	
S-ILS 28L		SA CAT II RA 100/12	100 DA 915	

SA CATEGORY I & II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

COLUMBUS, OHIO
Amdt 31 22APR21

JOHN GLENN COLUMBUS INTL (CMH)
40°00'N-82°54'W
ILS RWY 28L (SA CAT I & II)

TDZL/RCLS Rwy 10R-28L
HRL Rwy 10R-28L and 10L-28R