

COLUMBUS, OHIO

AL-94 (FAA)

25107

WAAS CH 86619	APP CRS 281°	Rwy Idg 8000
W28B		TDZE 813
		Apt Elev 815

RNAV (GPS) Y RWY 28R

JOHN GLENN COLUMBUS INTL (CMH)


RNP APCH.

Simultaneous approach authorized. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -19°C or above 54°C. LNAV procedure NA during simultaneous operations. Use of FD or AP providing RNAV track guidance required during simultaneous operations. For inop ALS, increase LNAV/VNAV all Cats visibility or RVR 4500; increase LNAV Cat C/D visibility to 1/2 SM. #RVR 1800 authorized with use of FD or AP or HUD to DA.

MALS R

MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct APE VORTAC and hold.


D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC
---------------------	--	-----------------------------------	----------------------------	-----------------------	-------

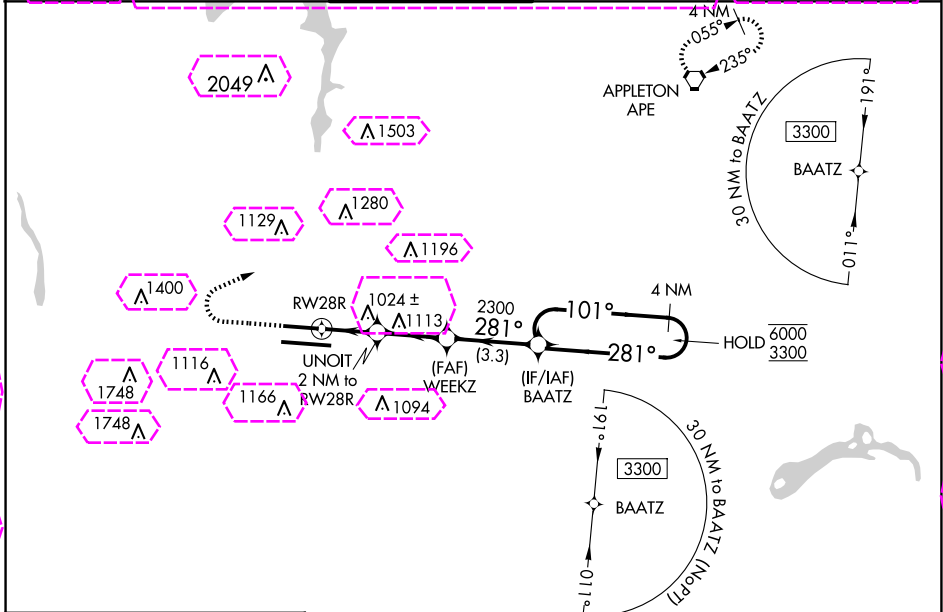

EC-2, 30 OCT 2025 to 27 NOV 2025

EC-2, 30 OCT 2025 to 27 NOV 2025

ELEV 815	D	TDZE 813
----------	----------	----------

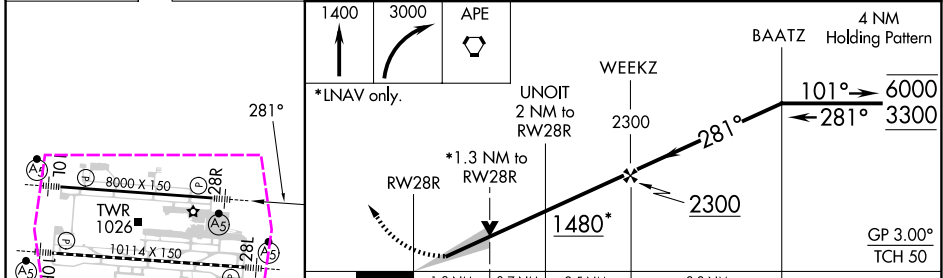

CATEGORY	A	B	C	D
LPV DA #		1013/24	200 (200-1/2)	
LNAV/VNAV DA		1096/24	283 (300-1/2)	
LNAV MDA	1280/24	467 (500-1/2)	1280/50	467 (500-1)
CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2)	1520-2 1/4 705 (800-2 1/4)

TDZ/CL Rwy 10R-28L
HIRL Rwy 10R-28L and TOL-28R

COLUMBUS, OHIO
Amdt 3 22APR21

40°00'N-82°54'W

RNAV (GPS) Y RWY 28R

COLUMBUS, OHIO

AL-94 (FAA)

25331

WAAS CH 86619 W28B	APP CRS 281°	Rwy Ldg TDZE Apt Elev	8000 813 815
--	------------------------	-----------------------------	---

RNAV (GPS) Y RWY 28R

JOHN GLENN COLUMBUS INTL (CMH)


RNP APCH.

Simultaneous approach authorized. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -19°C or above 54°C. LNAV procedure NA during simultaneous operations. Use of FD or AP providing RNAV track guidance required during simultaneous operations. For inop ALS, increase LNAV/VNAV all Cats visibility or RVR 4500; increase LNAV Cat C/D visibility to 1 3/8 SM. #RVR 1800 authorized with use of FD or AP or HUD to DA.

MALS R

MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct APE VORTAC and hold.


D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6
------------------------	---	--------------------------------------	-------------------------------

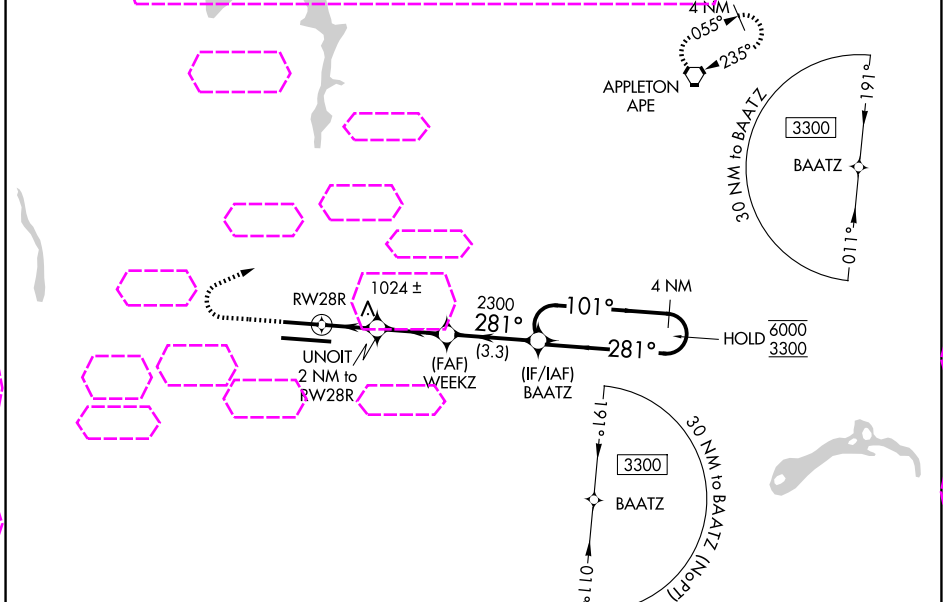

EC-2, 27 NOV 2025 to 25 DEC 2025

EC-2, 27 NOV 2025 to 25 DEC 2025

ELEV 815	D	TDZE 813
----------	----------	----------

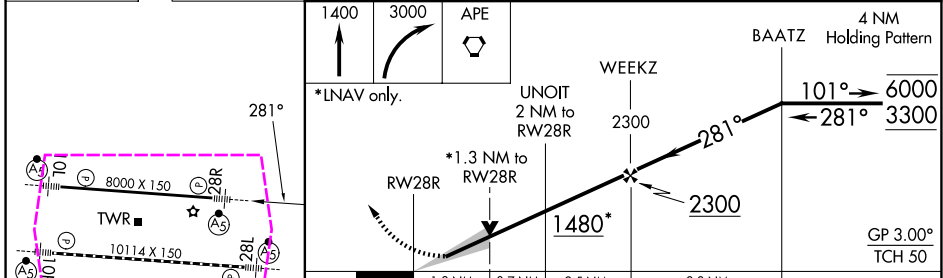

CATEGORY	A	B	C	D
LPV DA #		1013/24	200 (200-1/2)	
LNAV/VNAV DA		1096/24	283 (300-1/2)	
LNAV MDA	1280/24	467 (500-1/2)	1280/50	467 (500-1)
TDZL/RCLS Rwy 10R-28L HIRL Rwy 10R-28L and TOL-28R			1520-2 705 (800-2)	1520-2 1/4 705 (800-2 1/4)
CIRCLING	1340-1	525 (600-1)		

COLUMBUS, OHIO
Amdt 3 22APR21

40°00'N-82°54'W

RNAV (GPS) Y RWY 28R